


A NEW METHOD
OF
TESTING REINFORCED CONCRETE SLABS

C. A. ECKLUND
A. A. EBERT
H. W. YOUNGBERG

ARMOUR INSTITUTE OF TECHNOLOGY

1909

620.1
Ec 5

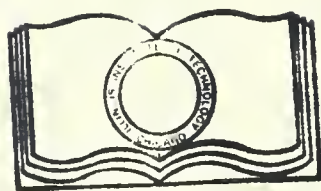

**Illinois Institute
of Technology
Libraries**

AT 140

Ecklund, Conrad Arthur.

A new method for testing
reinforced concrete slabs

A NEW METHOD
for
TESTING REINFORCED CONCRETE SLABS.

A Thesis presented by

Conrad Arthur Ecklund

Alfred August Ebert

Harry Walter Youngberg

to the

PRESIDENT and FACULTY

of the

ARMOUR INSTITUTE OF TECHNOLOGY

for the degree of

BACHELOR of SCIENCE in CIVIL ENGINEERING

having completed the

prescribed course of study in

CIVIL ENGINEERING.

ILLINOIS INSTITUTE OF TECHNOLOGY
PAUL V. GALVIN LIBRARY
35 WEST 33RD STREET
CHICAGO, IL 60616

CHICAGO

1909

A. C. Morrison
Dean of Civil Engineering

Alfred S. Phillips
Prof Civil Engineering
H. M. Raymond
Dean of Engineering

I. INTRODUCTION

1. PRELIMINARY. - Numerous tests have been made on reinforced concrete floor slabs, but the majority of them were conducted to demonstrate the safety of a particular design. Very few have had the aim of securing data for the formulating of some general and rational method of design. In consequence, very little is known in regard to the theory of this very important element of reinforced concrete building construction. Designers are generally guided by their judgment gained from their own experience and those of others, and use the existing theories, so-called, merely as a check in their work.

The objections to the tests usually made are: first, the condition of a uniformly distributed load has not been attained as required for a basis of design; and second, accurate measurements of increments of loading, necessary for the establishment of a relation between the loads and resulting stresses, has never been made. As far as is known, all tests heretofore conducted have consisted in the piling of weights such as pig-iron, sand in bags or loose, and similar weights all of which offer more or less support to each other and thereby cause an indeterminate element in the distribution and intensity of loading upon the slab. Moreover the accurate measurement of the increments of loading is impossible. Such conditions preclude the establishment of any theory for the design of

1. The first part of the document discusses the importance of maintaining accurate records of all transactions and activities. It emphasizes that proper record-keeping is essential for transparency and accountability, particularly in financial matters. The text suggests that organizations should implement robust systems to track income, expenses, and assets, ensuring that all data is up-to-date and easily accessible.

2. The second section focuses on the role of internal controls in preventing fraud and mismanagement. It outlines various measures that can be put in place, such as segregation of duties, regular audits, and the establishment of clear policies and procedures. The document stresses that these controls are not just for compliance but are also vital for the long-term health and sustainability of the organization.

3. The third part of the document addresses the challenges of budgeting and financial planning. It acknowledges that creating a realistic budget can be difficult, especially in a dynamic environment. However, it provides guidance on how to develop a budget that is both ambitious and achievable, highlighting the importance of regular reviews and adjustments. The text also discusses the benefits of having a clear financial plan, such as improved decision-making and better resource allocation.

4. The final section discusses the importance of communication and collaboration in achieving organizational goals. It argues that no single department or individual can succeed in isolation. Instead, it is through the effective exchange of information and the pooling of resources that an organization can truly thrive. The document encourages leaders to foster a culture of open communication and teamwork, where everyone feels responsible for the success of the organization as a whole.

reinforced concrete slab construction.

The object of this thesis is primarily to show the adaptibility of a hydraulic machine for the testing of slabs. It is believed that the machine used and described in the following pages removes the undesirable conditions mentioned above, and because of its cheapness, simplicity and ease of manipulation may be of some value. The number of slabs tested was restricted by the size of the room available for making, storing and testing the specimens, and by the time required to design the apparatus, make the slabs and perform the experiment. It being undesirable to install a crane or hoist, the size of the slabs was determined by the weight that could be readily moved and lifted with crow-bars and levers. Accordingly, only a few slabs have been tested and insufficient data is at hand for a proper comparison and conclusion. It is hoped that the difficulties encountered in the conduct of the test and discussed in the following pages, may be of some service.

2. SCOPE OF THESIS. - Six slabs of varying amounts and methods of reinforcement were tested. Eight slabs had been made, comprising four different sets, but owing to accidental failures the test data for six slabs only was secured. The four sets of slabs were: (1) Steel placed 4" center to center along short span; (2) Steel placed 4" center to center along long span; (3) Steel placed 4" center to center placed along both short and

long span combined; (4) Steel along both spans placed 3" center to center. The slabs were 3" thick and had dimensions of 3 1/2 ft. by 5 ft. They were made of a 1:2:4 mixture reinforced by 5/16" plain round rods of medium steel placed 1/2" from the surface. The age of the slabs varied from five to six months when tested.

Deflections and extensions at the center point of the slabs were taken in a continuous set of readings up to the breaking load. The extensions were determined at center of slab and from this data the unit deformation per load on a square foot of slab was calculated. An attempt has been made to calculate the unit stresses by the application of Prof. Talbot's beam formulae and the calculated unit deformations corresponding have been compared with the observed deformations. Since the extensometer has been calibrated by an indirect method, it is believed that its readings should be multiplied by some constant, and accordingly a constant relation should hold between the observed and calculated values of the deformations. Curves have been plotted which show the relation that does exist. Deflection curves have also been plotted. The action of the slabs under varying loads and the method of failure were observed. Besides the collection of the above data, the behavior of the machine and the difficulties encountered have been noted; and from this experience a discussion of a properly designed machine and various suggestions follow.

3. ACKNOWLEDGMENTS. - The tests were performed in a special laboratory provided by Armour Institute of Technology, and the work was made possible by the financial assistance of the department of civil engineering.

Acknowledgment is due Prof. Phillips and Prof. Wells for assistance and encouragement, to Prof. Wilcox for advice with regard to the extensometer used, to Mr. W. F. Dietzsch for valuable suggestions, and to Mrs. Julia Beveridge for furnishing references.

II. MATERIALS, TEST PIECES, THE MACHINE AND METHOD OF TESTING.

4. STONE. - The stone used was a rather soft limestone and was ordered to pass through a $3/4$ " screen and over a $1/4$ " screen. It contained, however, a considerable amount of dust and small stones. The percentage of voids was determined by tests to be 44.5% and the weight of the stone was found to be 35 lbs. per cu. ft.

5. SAND. - A good quality of graded and clean torpedoe sand was used. The percentage of voids was determined as 30.1%. The sand weighed 101 lbs. per cu.ft.

6. CEMENT. - The Owl Cement manufactured by the German-American Portland Cement Co. was used. The results of tests on standard briquettes of neat and 1:3 mortar are given in Table I.

7. CONCRETE. - The concrete was made by the writers of this thesis. A 1:2:4 mixture was made, the materials being proportioned by a bottomless measuring box. The cement and sand were mixed thoroughly while dry and then water was added until a stiff mortar was formed. The stone which had previously been wetted was then added and the entire mass was turned over with the shovels about four or five times. Water was slowly added while mixing until a rather wet mixture was attained. Table II gives the compressive strength of the various batches of concrete mixed. The concrete weighed 148 lbs. per cu. ft.

8. STEEL. - The steel used was rather soft and ductile. The percentage of elongation was determined as 22. The value of the yield point was 50647.^{lb} Plain round rods of 5/16" diameter were used exclusively. Table III gives the values of the tension tests on the steel used.

9. FORMS. - The forms consisted simply of bottomless boxes made of 2" x 3" pieces. Two iron rods at the ends and a notched 2" x 4" at the center prevented the form from bulging upon depositing of concrete. Plate I shows the construction of the forms.

10. SLABS. - As already indicated, eight slabs were made, each being 3" thick, 3 1/2 ft. wide and 5 ft. long. Table IV gives all slabs that were made and shows the amount and method of reinforcement, date of make and degree of wettness of concrete.

The slabs were made directly upon the cement floor with the aid of the bottomless forms, the cement floor having been oiled and then covered with well greased paper. Strips of wood $1\frac{1}{2}$ " x $\frac{3}{4}$ " in section were placed at the end of the span where needed to support the reinforcement $1\frac{1}{2}$ " from the surface. To lessen the sag, stiff 1:3 mortar was placed under the steel rods to a thickness of about $1\frac{1}{2}$ ". No difficulties were encountered in placing the reinforcement loose and unsupported except at the ends. Concrete was then spread in one layer in the forms and thoroughly tamped, until water flushed to the surface, especial care being taken to prevent displacement of the steel rods. Special attention was given to secure an absolutely smooth concrete surface, and that the four corners of the slab were in one plane. Much depends upon securing this condition for a successful conduct of the tests as will be discussed later.

11. STORAGE OF SLABS. - The concrete slabs were left in the position as made until the beginning of the tests, when the forms were removed and the slabs placed in stacks. During the first few weeks the slabs were kept continually wet, but later they were wetted occasionally only, rapid evaporation being retarded by a covering of wet sand.

12. TESTING MACHINE. - Plate II shows the plan, end and side view of the machine used, and illustrates the slab in position. The machine, which was built in the shops

of Armour Institute of Technology, consists simply of a watertight wooden platform (B) having four sills (S) placed along its edges upon which the slab (A) rests, a watertight line of contact between the sills and slab being secured by piston packing (P) compressed by the use of clamps (C) as indicated. The shallow watertight compartment thus formed between the platform and slab holds water under a "head" which exerts a uniform upward pressure against the slab. The iron pipe (D) which enters the compartment through the bottom of the platform is attached to a hose (H) having a reservoir (R) at its end that can be raised or lowered by use of rope and pulleys according to the pressure desired. A mercury manometer (M) measures the pressure against the slab in pounds per square foot.

Plate III shows the machine in section with the slab in position, and illustrates its construction. The platform is 6" thick, 3 1/2 ft. wide and 5 ft. long, the same as that of the slabs, and was constructed of a selected quality of white pine lumber. The six inches of thickness were secured by three layers of 2" x 6" planking securely held together by wood screws. In the bottom and upper layers, the lengths of the planks were placed along the short span and the intermediate layer along the long span. The upper surface of the platform was made as near watertight as possible by calking the grooves in the joints with hemp and by covering the entire surface with about

1/2" of roofing tar. The sills securely screwed to the platform alongs its four edges were 3/4" high at the center and 3" wide, its center being 3" from the edge of the platform as indicated. The joints of the sills at the four corners were thoroughly calked with hemp and their entire surface was also covered with tar. One length of 1/2" Eureka piston packing, spliced as indicated in the drawing, was placed upon the center of the sills. The slab, resting upon this packing with its edges coinciding with those of the platform, was firmly clamped to the platform by 18 clamps, as shown in the drawing.

The mercury manometer was an ordinary U tube, made by connecting two glass tubes with a piece of rubber tubing covered with adhesive tape, and placed against a special graduated scale which gave the pressures directly in pounds per square foot.

13. EXTENSOMETER. - The upper side of the slab being a plane surface without any projections, it was impossible to use a commercial extensometer to measure deformations. An instrument that could be read at any instant was desirable. In searching for an extensometer to satisfy these requirements a diagram was found of one devised by Mr. Walter C. Durfee of Harvard University. The principle was adopted and Plate IV is the design of the instrument, which was constructed in the shops of Armour Institute of Technology.

It is a bar with a pointed stud (a) and a roller (b). The stud anchors the instrument so that a deformation of the material under the extensometer causes a rotation of the roller. The roller carries a flat circular glass plate (c) so placed that its upper surface intersects the center-line of the roller. On this plate rests a lens (d) with a radius of curvature of 160 inches, mounted on a lever (e). A movement of the roller changes the point of contact, there being a cam-like action by the plate and lens. The interference of light phenomenon, known as Newton's rings, indicates the position of the contact point. Graduations on the lens determined the movement of the point. To calibrate the instrument a lever was attached to the roller and a micrometer was placed 10 inches from the center of the roller as shown in (f). The movement of the rings corresponding to a definite micrometer reading was noted for all divisions of the scale. A calibration curve has been plotted. The average ratio between extensometer reading and actual extension was used.

14. METHOD OF TESTING. - The steel rods and the 1" cubes were tested on the 60000# Olsen machine, the 6" concrete cubes on the 200000# Riehle machine, the briguettes on the Fairbanks machine, while the slabs were tested on the machine shown in Plates II and III.

The slabs weighed about 650# each and were moved to and from the machine by means of crow bars and rollers.

After the packing was placed, the slabs were put into position by rolling them up two 2" x 4" scantlings slanting from the machine to the floor. The steel reinforcing was on the upper size. The packing was given final adjustment and then the slabs were clamped down so as to make a water-tight fit between the slab and the machine. Any unevenness in the slab at its edges, which would be liable to cause undue leaking, was removed by the application of neat cement, which was allowed to set for several days before the test was carried out. Plaster of Paris was applied to the top of the slab so as to make the cracks more noticeable and also to form a smooth surface for the roller of the extensometer.

The center deflections were read on all slabs by means of a vertical scale (a) graduated to 64ths of an inch, and a dumpy level placed at a distance of about 12 feet from the slab. The magnifying power of the level made it possible to easily estimate to 256ths of an inch. The deformation of the upper fibre was measured by the extensometer shown in Plate IV. The extensometer was placed so as to obtain readings for both the long and the short spans of each set of slabs, but having only one instrument its position was changed in testing similar slabs and one set of readings of each kind was obtained.

It was found that three men were necessary to conveniently carry out the tests. One man at the level

to read deflections, one at the rope to vary the load and read the mercury column, and one at the extensometer to read the extensions and to make note of the appearance of cracks. The first step in the actual performance of the test was to obtain zero readings of the extensometer and deflection scale when the mercury column registered no load. There is a slight error introduced into these zero readings and consequently into all subsequent readings, which is negligible. This error is due to the position of the mercury column, because when it denotes no pressure there really exists a pressure on the slab in inches of water, equal to the difference in elevation between the bottom of the slab and the contact plane of the water and the mercury in the mercury column. The pressure on the slab was increased by slowly raising the reservoir, and at increments of from 100# per square foot to 200# per square foot, readings were taken.

With several of the slabs considerable difficulty was experienced due to excessive leaking between the slab and the packing. This was particularly true under the greater pressures, in which case there was also a tendency to force the packing out of place. When these extreme leaks occurred the reservoir emptied quickly, causing a drop in the head and a consequent lowering of the pressure. Under such circumstances the leaks were stopped by driving the packing in tightly between the

machine and the slab, using a flat piece of steel with rounded edges. The reservoir was refilled and the test continued up to the point of failure. Although the machine was not absolutely water-tight, any ordinary small leak was taken care of by the supply in the reservoir without causing a fall in the pressure.

III. EXPERIMENTAL DATA & DISCUSSION.

15. DISCUSSION OF MACHINE. - The performance of the testing machine was satisfactory and no serious difficulties were encountered. The machine lacked perfection in some details, causing inconveniences that might have been avoided.

To design a platform that would withstand the repeated loading necessary to break the eight slabs, was a problem of some uncertainty, because the strength of the slabs when supported on four sides was an unknown quantity. The thickness of the platform (six inches) was designed, approximately, with a large factor of safety, and it was found that the platform was in good condition at the termination of the tests. The attainment of a water-tight surface presented some difficulties. It seemed impossible to make the platform absolutely impervious, therefore it was decided to use a small reservoir so as to replenish the loss due to these unavoidable leaks. A constant "head" was thus maintained. In this platform all joints exposed to the water had grooves cut $1/4$ " wide and $1\ 1/2$ " deep which were thoroughly calked



with jute. The entire surface was covered with roofing tar to a depth of $1/2$ ". Experience showed that too great care can not be taken in water-proofing the surface.

The number, size and spacing of the clamps which took the reactions of the slab and also firmly gripped the slab to the platform was determined as accurately as possible. It was found however that the clamps were sprung slightly out of shape at the end of the tests. This was due chiefly to overstressing the clamps in placing them.

The use of a reel with a ratchet would facilitate the work of raising and lowering the reservoir. It was also found that a sliding scale for the mercury column would aid the observer in making rapid readings.

The highest recorded load was 1900# per sq.ft. and it was obtained with but little trouble because the slab used in this case had a smooth and plane surface. Slabs that were not made so carefully were given a coating of cement mortar at the contact surface of the packing. Under these conditions a pressure of 1000# to 1200# per sq.ft. was maintained satisfactorily, but for greater pressures leakage occurred between the slab and the mortar. The fact was brought out that in order to avoid this trouble the slab should be absolutely smooth and plane. This is a vital point to consider. As previously stated the slabs were constructed in bottomless forms placed on the cement floor which was supposed to furnish a plane

surface. However, when the slabs were to be tested, it was found that the majority did not have a plane surface. The only satisfactory method of slab construction involves the use of forms having bottoms. When the slabs are made, a coating of neat cement mortar should be spread on that part of the surface which will be in contact with the packing during the test.

Under very high pressures the behavior of the machine revealed a defect in that the packing was displaced sufficiently to cause serious leaks and a consequent rapid lowering of the pressure. A shallow groove made to receive the packing would prevent this dislodgement. If slabs of greater spans had been tested, such excessive loads would not have been necessary. This would mean fewer leaks which always cause delays and interruptions in a continuous set of readings.

16. DISCUSSION OF THEORIES. - A preliminary discussion in regard to the action of slabs or plates under either a uniform or concentrated load would be proper. As already indicated, no theory based upon experimental results, such as is the case for reinforced concrete beams, is in existence for reinforced concrete slabs. However, for plates of a homogeneous material, various theories have been advanced by such authorities as Bach and Grashof, as a result of their tests on steel plates supported or fixed on all sides; but they differ in that the former assumes the sections through

the diagonals as the planes of greatest stress, whereas the latter assumes the mid section parallel to the greater span as that of the greatest stress. Hence, we see that even in the case of plates made of a homogeneous material such as steel, there is a difference of opinion in regard to the magnitude of the maximum bending moment and to the position of the sections along which it acts. Besides the uncertainty as to the value of the maximum bending moment, the determination of the stresses becomes a matter of great difficulty due to their complexity. The directions of the stresses vary at all points and the effect of lateral contraction is an uncertain element.

In the case of reinforced concrete slabs, this extremely difficult problem is still further complicated. The additional difficulty arises from the fact that the steel reinforcement which is placed rectangular, lies in the direction of the resultant stresses at a few points only, and accordingly the application of any reinforced concrete beam formula becomes a matter of doubtful propriety. An assumption can, however, be made that the rectangular placed steel rods take their respective components of the resultant stress, the concrete preventing any lateral movement of the rods. It would be practically impossible to attempt the determination of the stress in the steel by a method based upon the resolution of stresses, and consequently in the computations that follow the stress in the steel




has been computed with the assumption that it takes the direct tensile stress due to the maximum bending moment. The direction of the cracks in the slabs as is shown in the accompanying sketches indicate that the assumption is a reasonable one.

In regard to the compressive stresses in the concrete, still greater trouble is experienced since practically nothing is known as to the effect of lateral contraction in concrete. In computing the compressive stresses in steel plates Bach and Grashof use a constant, the coefficient of lateral contraction in their computation of the extreme fibre stresses. Because of the uncertain behavior of concrete in this respect it will be also assumed that the concrete takes the direct compressive stress, no attention being given to lateral contraction.

A reasonable formula, either empirical or rational, is desired. The formulas of Bach have been suggested as applicable to reinforced concrete slabs. Considerable objection, however, is raised to this assumption, because reinforced concrete is not a homogeneous material of equal strength in all directions. His derivation follows.

Having observed from experiment that square or nearly square plates, supported on four sides usually fracture along a diagonal, Bach derived a simple formula which gives the bending moment along this diagonal.

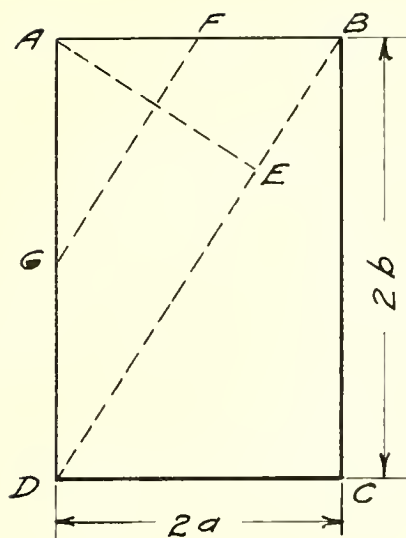

Let A B C D represent the slab. Draw the diagonal B D and consider the forces on the left hand side. The resultants of the reactions along A B and A D are located at the mid-points F and G respectively. Therefore the resultant of the reactions will lie on the line F G.

Let A E equal (C) and the pressure (p). The load on the portion A B D, equal to $2 p a b$, acts at the center of gravity of A B D. The bending moment about the line B D equals $2 p a b \left(\frac{c}{2} - \frac{c}{3} \right) = \frac{p a b c}{3}$. An objection to the application of this formula arises in determining the maximum bending moment at the center, for it does not remain constant at all points along the diagonal. The fact that a diagonal crack starts at the center travels diagonally to the supports is not proof that the maximum stresses follow the diagonal, for when a crack starts in a brittle material like concrete, very small loads will lengthenthe crack.

Another method used is to calculate the bending moment as if the slab was a simple beam on two supports and then multiply by coefficients depending on the span considered. The coefficient formula of Grashof and

Rankine is
$$r = \frac{a^2}{a^2 + b^2}, \quad s = \frac{b^2}{a^2 + b^2}.$$

The French government has given its engineers the formula

$$r = \frac{1}{1 + \frac{2a}{b}}, \quad s = \frac{1}{1 + \frac{2b}{a}}.$$

In both formulas (a) represents the long span, (b) the short span, and (s) and (r) the coefficients which are to be used for determining the bending moment for the short and long spans respectively. The reasoning necessary to establish these formulas is not entirely satisfactory. Strips at right angles are assumed to have equal center deflections in Grashof and Rankine's formula. These formulas can be used only when the strength of the slab to resist bending is the same in both directions.

The above formulas could be made more satisfactory by supplying constants obtained from experiments, thus giving them an empirical form. Nothing has been done to prepare such a systematic series of constants.

The distribution of reactions involves complicated analyses. Various radically different assumptions are made in regard to the magnitude of the reactions at points along the supports.

17. DISCUSSION of RESULTS of TEST. - All slabs tested were broken, but maximum loads were obtained for A1, A2, B1 and B2 only. In tables under the headings A1, A2, B1, B2, C1 and C2 are given the center deflection and extension readings for various intensities of loading. The actual deflections and the unit extensions are also given. The extensions were taken along what was thought to be the weaker span so that the maximum extensions could be measured. The extensometer was placed for each slab as indicated below:-

A1	-	extensometer along greater span
A2	-	" " lesser "
B1	-	" " lesser "
B2	-	" " longer "
C1	-	" " lesser "
C2	-	" " lesser "

A1 and A2 broke along longer span as was expected; but it was supposed that B1 would break along the shorter span parallel to the reinforcing, and the extensometer was placed accordingly. It failed, however, along the longer span.

An attempt to compare the observed unit deformations with the calculated deformations as determined by the application of Talbot's beam formula has been made. Since the exact value of the maximum bending moment is an unknown quantity and the application of Talbot's formula is not correct, as already discussed, no agreement between the

observed and calculated values can be expected. Grashof's formula and the expression given out by the French government have both been used in the calculation of the maximum bending moments. Following is given a sample calculation for the deformation on the tension side for each of the two values of bending moment.

18. SAMPLE CALCULATION. -

Average strength of concrete 3126 # per sq. in.

Percent of reinforcement .807% $\therefore p = .00807$

Ratio of Moduli of Elasticity 8.34 = e

All symbols used same as in Talbot's Formula

Coeff. of bending moment $\frac{a^4}{a^4 + b^4} = .835$

$$M = \frac{.835}{8} w l^2 = .104 w l^2$$

Load 1000 # per sq. ft. $M = 11232$ in. lbs.

Assume $c = 1000$ # $\frac{c}{c'} = \frac{1000}{3126} = .32$

$$q = \frac{2 \pm \sqrt{4 - 1.28}}{2} = .175$$

$$k = \sqrt{.1712 + .0073} - .0856 = .3369$$

Given $d = 2.375$ " $kd = .801$ "

$$z = \frac{.801}{3} \left(1 + \frac{.175}{4 \times 2.825} \right) = .271" \quad \therefore d - z = 2.104"$$

$$M = fA(d - z) \quad \therefore f = \frac{11232}{.2301 \times 2.104} = 23200 \text{ # per sq. in.}$$

$$\therefore \lambda_s = .00077"$$

$$\text{Elongation of Concrete} = \frac{2.199}{1.574} .00077 = .00107"$$

$$\text{French coeff} = \frac{1}{1 + \frac{2b}{a}} = .71 \quad \therefore M = \frac{.71}{8} w l^2 = .089 w l^2$$

Assume $d - z$ constant

$$f = \frac{9610}{.2301 \times 2.104} = 19770 \text{ # per sq. in.} \quad \lambda_s = .000686"$$

$$\text{Elongation of concrete} = \frac{2.199}{1.574} .000686 = .000956"$$

19. CURVES. - Extension and deflection curves have been plotted for each slab showing the relation existing between these values and the various loads.

The deformation curve for A1 is characteristic of the behavior of concrete. The yield point is reached at a load of about 1000# per sq.ft. and for slightly higher loading the concrete extends rapidly without increase of load. The curve for A2 should be similar to that of A1; it is not quite as steep, however. At a load of about 650# per sq.ft. the slab yielded without increase of load. The deflection curves for both slabs incline toward the X- axis for high loads:

The extension curves for both B1 and B2 show that the slabs yielded at a loading of about 1100# per sq.ft. The curve for B2 is somewhat steeper than that for B1, showing that the deformations were smaller for the long span. The curve for B2 again becomes steep for loadings greater than 1200# per sq.ft., and that for B1 has the same tendency. The deflections increase greatly for both slabs for loadings above 1000# per sq.ft.


The yield point for C1 is reached at a loading of 1400# per sq.ft. and that for C2 at about 1100# per sq.ft. The effect of steel reinforcing along both spans is shown in that the ultimate rupture is greatly delayed.

20. MANNER of FAILURE. - The failures of A1 and A2 were characteristic concrete tension failures. The rupture


occurred suddenly without warning, the slab being broken into two equal portions by fracture through its center parallel to the longer span, as indicated in the diagrams showing cracks for A1 and A2. The nature of this failure was to be expected, since the reinforcement was placed along the longer span.

The slabs B1 and B2, with steel along the shorter span, showed a marked difference in their behavior as compared with the A series slabs. The slabs, C1 and C2, with reinforcement along both spans, behaved in a similar manner except that the ultimate loadings were somewhat greater. Failure and the position of the line of fracture were anticipated by the appearance of moisture along lines. For low pressure isolated beads of percolating water were observed on the slabs. As the pressure was increased, these beads became more numerous, and determined the position of the fracture line. No cracks could be detected upon the first indication of moisture; but, when a moisture line was established, very fine hair cracks could be seen. Upon rupture the water welled out, and the slabs closed up, the cracks still being noticeable. It is believed that the actual ultimate failure did not occur for these four slabs, but that some value very close to the ultimate value was reached. The calculations for the compressive stress in the concrete and the tensile stress in the steel indicate that the


ultimate strength for both was not reached. Partial failures, however, occurred for all slabs at about 1000# to 1300# per sq.ft. where the concrete broke in tension. All deformation curves show this similarity, indicating clearly that a partial failure occurred for concrete in tension. It was impossible to examine the compression side of the slabs after failure without disturbing the condition of the slabs as left at the end of the test. Accordingly no information was obtained as to the appearance of the slabs on the compression side. If a compression failure had occurred, it may have been evidenced by pieces of broken concrete in the machine. Such was, however, not observed. Diagrams indicate the position and number of cracks.

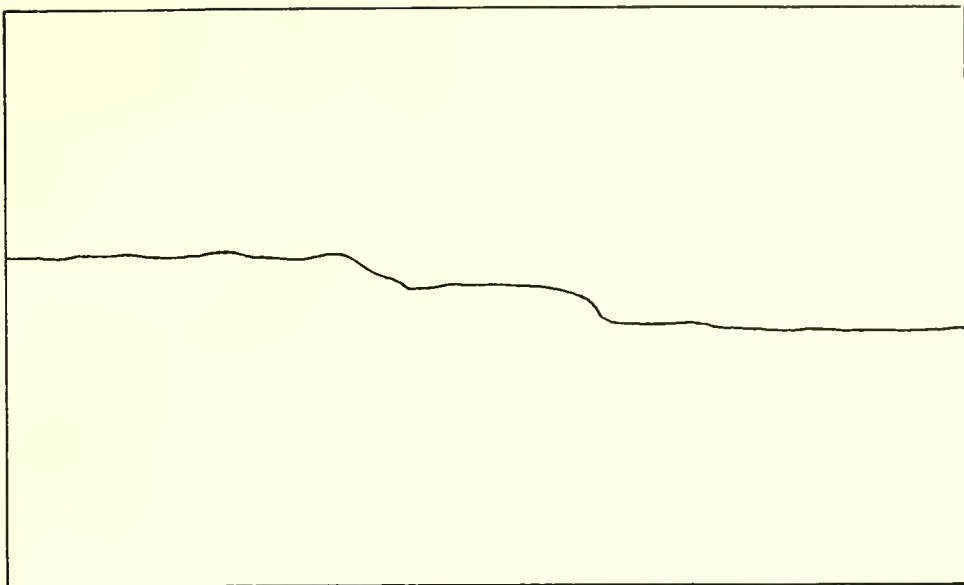


SLAB A 1

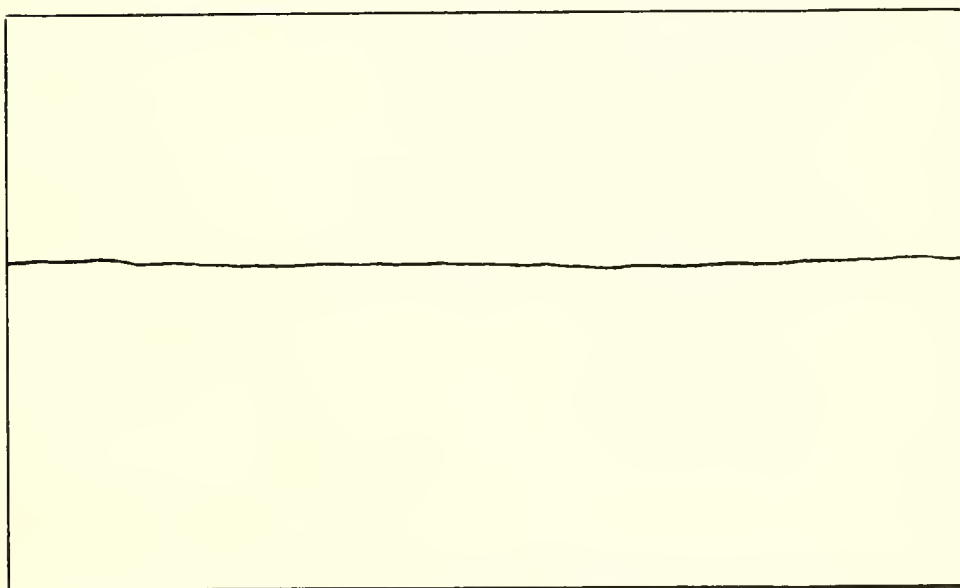


SLAB A 2

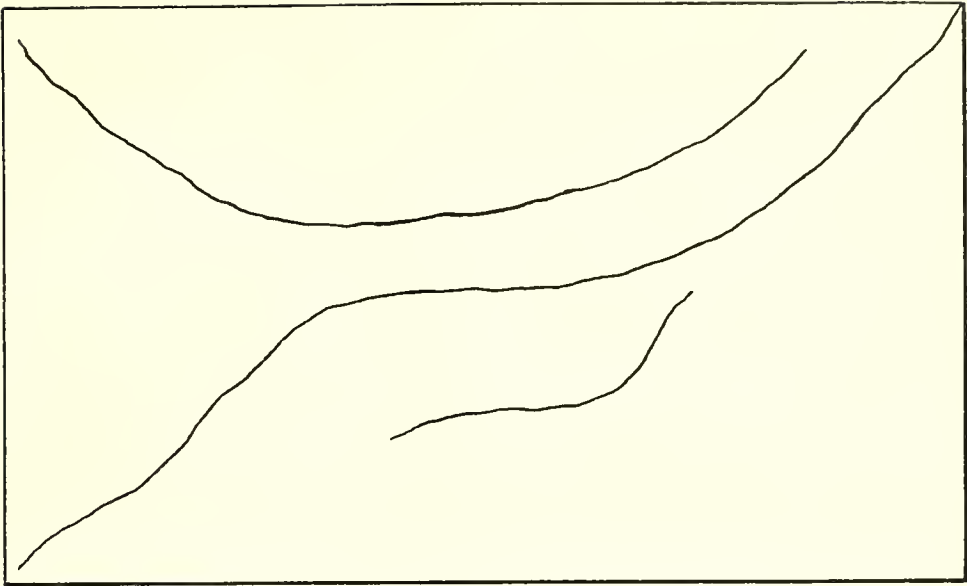


SLAB B1

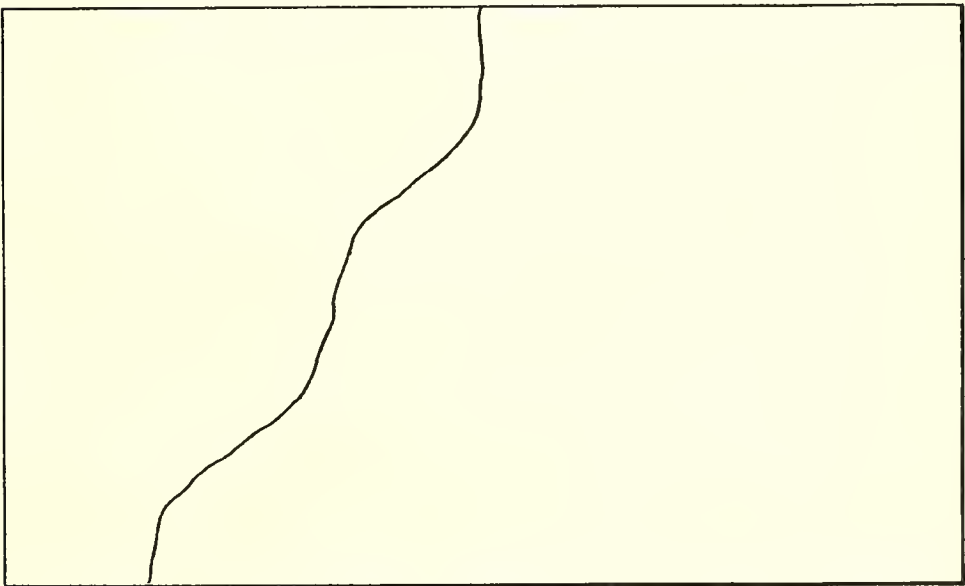

SLAB B2

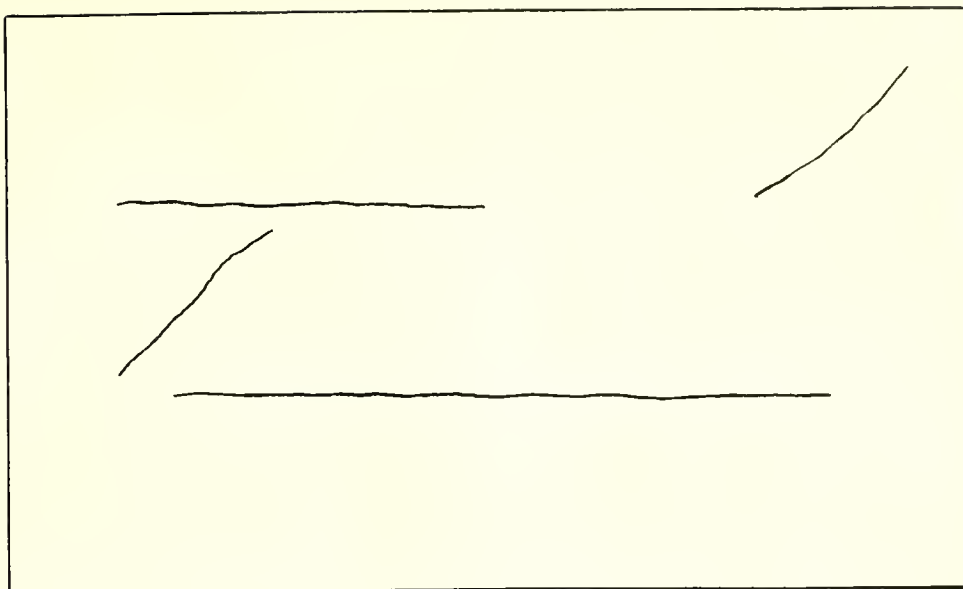

SLAB C 1

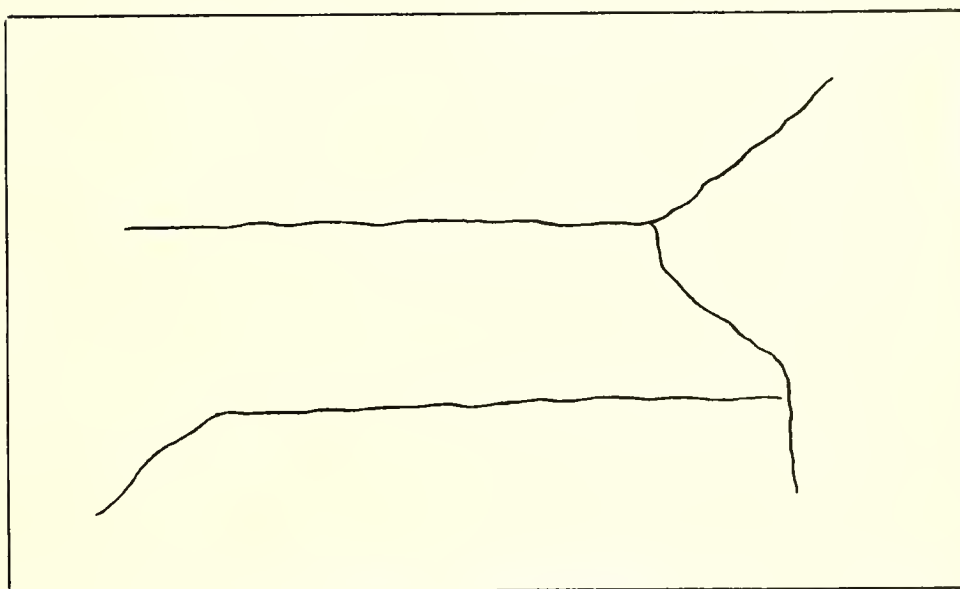

SLAB C 2

مجلس شورای اسلامی

SLAB A 1				
LOAD	Deflection		Elongation	
	Reading	Actual	Reading	Actual
0	1	.0000"	.28	.000000"
450	2	.0156"	.35	.000024"
650	3	.0312"	.39	.000037"
1000	4	.0469"	.45	.000058"
1100	-		1.54	.000428"

Load recorded in lbs per sq.ft.

Deflection reading measured in 64ths. of an inch.

SLAB A 2				
LOAD	Deflection		Elongation	
	Reading	Actual	Reading	Actual
0	0	.0000"	.98	.000000"
275	$\frac{1}{2}$.0078"	1.15	.000058"
350	$\frac{3}{4}$.0117"	1.20	.000075"
460	1	.0156"	1.29	.000105"
575	$1\frac{1}{4}$.0195"	1.38	.000136"
620	$1\frac{1}{2}$.0234"	1.41	.000146"
660	$1\frac{3}{4}$.0273"	1.56	.000197"
720	2	.0312"	1.60	.000211"
880	$2\frac{3}{4}$.0429"	1.70	.000245"
950	3	.0469"	1.74	.000258"

Load recorded in lbs. per sq. ft.
 Deflection reading measured in 64ths. of an inch.

SLAB B 1				
LOAD	Deflection		Elongation	
	Reading	Actual	Reading	Actual
0	0	.0000 "	.45	.000000 "
100	$\frac{1}{4}$.0039 "	.46	.000003 "
200	$\frac{1}{2}$.0078 "	.47	.000006 "
325	$\frac{3}{4}$.0117 "	.48	.000013 "
425	$\frac{7}{8}$.0136 "	.50	.000017 "
520	1	.0156 "	.51	.000024 "
625	$1\frac{1}{4}$.0195 "	.53	.000027 "
750	$1\frac{1}{2}$.0234 "	.55	.000034 "
825	$1\frac{3}{4}$.0273 "	.58	.000044 "
940	2	.0312 "	.60	.000051 "
990	$2\frac{1}{4}$.0352 "	.61	.000054 "
1075	$2\frac{1}{2}$.0390 "	.64	.000065 "
1100	$2\frac{3}{4}$.0429 "	.73	.000095 "
1075	4	.0625 "	.98	.000182 "
1100	$4\frac{1}{4}$.0664 "	1.03	.000197 "
1120	$4\frac{1}{2}$.0703 "	1.24	.000269 "
1200	$5\frac{1}{2}$.0860 "	1.48	.000350 "
1250	$6\frac{3}{4}$.1055 "	1.54	.000371 "
1320	8	.1250 "	-	-
1340	$8\frac{1}{4}$.1289 "	-	-
1450	$10\frac{1}{2}$.1640 "	-	-

Load recorded in lbs. per sq. ft.

Deflection reading measured in 64ths. of an inch.

SLAB B2				
LOAD	Deflection		Elongation	
	Reading	Actual	Reading	Actual
0	0	.0000"	.01	.000000"
200	$\frac{1}{3}$.0052"	.02	.000003"
400	$\frac{2}{3}$.0104"	.03	.000006"
600	1	.0156"	.05	.000013"
750	$1\frac{1}{4}$.0195"	.06	.000017"
900	$1\frac{1}{2}$.0234"	.07	.000020"
1000	$1\frac{3}{4}$.0273"	.10	.000031"
1175	$2\frac{3}{4}$.0429"	.56	.000187"
1250	$3\frac{1}{4}$.0508"	.56	.000187"
1350	$5\frac{3}{4}$.0898"	.56	.000187"
1450	$5\frac{3}{4}$.0898"	.58	.000194"
1525	6	.0938"	.61	.000204"

Load recorded in lbs. per sq. ft.

Deflection reading measured in 64ths. of an inch.

SLAB C 1				
LOAD	Deflection		Elongation	
	Reading	Actual	Reading	Actual
0	0	.0000"	.26	.000000"
225	$\frac{1}{2}$.0078"	.39	.000044"
250	$\frac{3}{4}$.0117"	.40	.000048"
400	$1\frac{3}{4}$.0195"	.45	.000065"
610	2	.0312"	.55	.000099"
675	$2\frac{1}{4}$.0352"	.57	.000105"
760	$3\frac{1}{2}$.0547"	.67	.000139"
980	4	.0625"	.74	.000163"
1300	$5\frac{3}{4}$.0899"	.90	.000218"
1425	$6\frac{1}{2}$.1016"	1.03	.000262"
1400	8	.1250"	1.07	.000275"
1550	$8\frac{3}{4}$.1368"	1.45	.000404"
1600	10	.1562"	1.39	.000453"
1700	12	.1874"	1.85	.000541"
1750	13	.2032"	2.20	.000659"
1700	$14\frac{3}{4}$.2305"	2.40	.000728"

Load recorded in lbs. per sq. ft.

Deflection reading measured in 64ths. of an inch.

1775
1776
1777
1778
1779
1780
1781
1782
1783
1784
1785
1786
1787
1788
1789
1790
1791
1792
1793
1794
1795
1796
1797
1798
1799
1800
1801
1802
1803
1804
1805
1806
1807
1808
1809
1810
1811
1812
1813
1814
1815
1816
1817
1818
1819
1820
1821
1822
1823
1824
1825
1826
1827
1828
1829
1830
1831
1832
1833
1834
1835
1836
1837
1838
1839
1840
1841
1842
1843
1844
1845
1846
1847
1848
1849
1850
1851
1852
1853
1854
1855
1856
1857
1858
1859
1860
1861
1862
1863
1864
1865
1866
1867
1868
1869
1870
1871
1872
1873
1874
1875
1876
1877
1878
1879
1880
1881
1882
1883
1884
1885
1886
1887
1888
1889
1890
1891
1892
1893
1894
1895
1896
1897
1898
1899
1900
1901
1902
1903
1904
1905
1906
1907
1908
1909
1910
1911
1912
1913
1914
1915
1916
1917
1918
1919
1920
1921
1922
1923
1924
1925
1926
1927
1928
1929
1930
1931
1932
1933
1934
1935
1936
1937
1938
1939
1940
1941
1942
1943
1944
1945
1946
1947
1948
1949
1950
1951
1952
1953
1954
1955
1956
1957
1958
1959
1960
1961
1962
1963
1964
1965
1966
1967
1968
1969
1970
1971
1972
1973
1974
1975
1976
1977
1978
1979
1980
1981
1982
1983
1984
1985
1986
1987
1988
1989
1990
1991
1992
1993
1994
1995
1996
1997
1998
1999
2000
2001
2002
2003
2004
2005
2006
2007
2008
2009
2010
2011
2012
2013
2014
2015
2016
2017
2018
2019
2020
2021
2022
2023
2024
2025
2026
2027
2028
2029
2030
2031
2032
2033
2034
2035
2036
2037
2038
2039
2040
2041
2042
2043
2044
2045
2046
2047
2048
2049
2050
2051
2052
2053
2054
2055
2056
2057
2058
2059
2060
2061
2062
2063
2064
2065
2066
2067
2068
2069
2070
2071
2072
2073
2074
2075
2076
2077
2078
2079
2080
2081
2082
2083
2084
2085
2086
2087
2088
2089
2090
2091
2092
2093
2094
2095
2096
2097
2098
2099
2100
2101
2102
2103
2104
2105
2106
2107
2108
2109
2110
2111
2112
2113
2114
2115
2116
2117
2118
2119
2120
2121
2122
2123
2124
2125
2126
2127
2128
2129
2130
2131
2132
2133
2134
2135
2136
2137
2138
2139
2140
2141
2142
2143
2144
2145
2146
2147
2148
2149
2150
2151
2152
2153
2154
2155
2156
2157
2158
2159
2160
2161
2162
2163
2164
2165
2166
2167
2168
2169
2170
2171
2172
2173
2174
2175
2176
2177
2178
2179
2180
2181
2182
2183
2184
2185
2186
2187
2188
2189
2190
2191
2192
2193
2194
2195
2196
2197
2198
2199
2200
2201
2202
2203
2204
2205
2206
2207
2208
2209
2210
2211
2212
2213
2214
2215
2216
2217
2218
2219
2220
2221
2222
2223
2224
2225
2226
2227
2228
2229
2230
2231
2232
2233
2234
2235
2236
2237
2238
2239
2240
2241
2242
2243
2244
2245
2246
2247
2248
2249
2250
2251
2252
2253
2254
2255
2256
2257
2258
2259
2260
2261
2262
2263
2264
2265
2266
2267
2268
2269
2270
2271
2272
2273
2274
2275
2276
2277
2278
2279
2280
2281
2282
2283
2284
2285
2286
2287
2288
2289
2290
2291
2292
2293
2294
2295
2296
2297
2298
2299
2300
2301
2302
2303
2304
2305
2306
2307
2308
2309
2310
2311
2312
2313
2314
2315
2316
2317
2318
2319
2320
2321
2322
2323
2324
2325
2326
2327
2328
2329
2330
2331
2332
2333
2334
2335
2336
2337
2338
2339
2340
2341
2342
2343
2344
2345
2346
2347
2348
2349
2350
2351
2352
2353
2354
2355
2356
2357
2358
2359
2360
2361
2362
2363
2364
2365
2366
2367
2368
2369
2370
2371
2372
2373
2374
2375
2376
2377
2378
2379
2380
2381
2382
2383
2384
2385
2386
2387
2388
2389
2390
2391
2392
2393
2394
2395
2396
2397
2398
2399
2400
2401
2402
2403
2404
2405
2406
2407
2408
2409
2410
2411
2412
2413
2414
2415
2416
2417
2418
2419
2420
2421
2422
2423
2424
2425
2426
2427
2428
2429
2430
2431
2432
2433
2434
2435
2436
2437
2438
2439
2440
2441
2442
2443
2444
2445
2446
2447
2448
2449
2450
2451
2452
2453
2454
2455
2456
2457
2458
2459
2460
2461
2462
2463
2464
2465
2466
2467
2468
2469
2470
2471
2472
2473
2474
2475
2476
2477
2478
2479
2480
2481
2482
2483
2484
2485
2486
2487
2488
2489
2490
2491
2492
2493
2494
2495
2496
2497
2498
2499
2500
2501
2502
2503
2504
2505
2506
2507
2508
2509
2510
2511
2512
2513
2514
2515
2516
2517
2518
2519
2520
2521
2522
2523
2524
2525
2526
2527
2528
2529
2530
2531
2532
2533
2534
2535
2536
2537
2538
2539
2540
2541
2542
2543
2544
2545
2546
2547
2548
2549
2550
2551
2552
2553
2554
2555
2556
2557
2558
2559
2560
2561
2562
2563
2564
2565
2566
2567
2568
2569
2570
2571
2572
2573
2574
2575
2576
2577
2578
2579
2580
2581
2582
2583
2584
2585
2586
2587
2588
2589
2590
2591
2592
2593
2594
2595
2596
2597
2598
2599
2600
2601
2602
2603
2604
2605
2606
2607
2608
2609
2610
2611
2612
2613
2614
2615
2616
2617
2618
2619
2620
2621
2622
2623
2624
2625
2626
2627
2628
2629
2630
2631
2632
2633
2634
2635
2636
2637
2638
2639
2640
2641
2642
2643
2644
2645
2646
2647
2648
2649
2650
2651
2652
2653
2654
2655
2656
2657
2658
2659
2660
2661
2662
2663
2664
2665
2666
2667
2668
2669
2670
2671
2672
2673
2674
2675
2676
2677
2678
2679
2680
2681
2682
2683
2684
2685
2686
2687
2688
2689
2690
2691
2692
2693
2694
2695
2696
2697
2698
2699
2700
2701
2702
2703
2704
2705
2706
2707
2708
2709
2710
2711
2712
2713
2714
2715
2716
2717
2718
2719
2720
2721
2722
2723
2724
2725
2726
2727
2728
2729
2730
2731
2732
2733
2734
2735
2736
2737
2738
2739
2740
2741
2742
2743
2744
2745
2746
2747
2748
2749
2750
2751
2752
2753
2754
2755
2756
2757
2758
2759
2760
2761
2762
2763
2764
2765
2766
2767
2768
2769
2770
2771
2772
2773
2774
2775
2776
2777
2778
2779
2780
2781
2782
2783
2784
2785
2786
2787
2788
2789
2790
2791
2792
2793
2794
2795
2796
2797
2798
2799
2800
2801
2802
2803
2804
2805
2806
2807
2808
2809
2810
2811
2812
2813
2814
2815
2816
2817
2818
2819
2820
2821
2822
2823
2824
2825
2826
2827
2828
2829
2830
2831
2832
2833
2834
2835
2836
2837
2838
2839
2840
2841
2842
2843
2844
2845
2846
2847
2848
2849
2850
2851
2852
2853
2854
2855
2856
2857
2858
2859
2860
2861
2862
2863
2864
2865
2866
2867
2868
2869
2870
2871
2872
2873
2874
2875
2876
2877
2878
2879
2880
2881
2882
2883
2884
2885
2886
2887
2888
2889
2890
2891
2892
2893
2894
2895
2896
2897
2898
2899
2900
2901
2902
2903
2904
2905
2906
2907
2908
2909
2910
2911
2912
2913
2914
2915
2916
2917
2918
2919
2920
2921
2922
2923
2924
2925
2926
2927
2928
2929
2930
2931
2932
2933
2934
2935
2936
2937
2938
2939
2940
2941
2942
2943
2944
2945
2946
2947
2948
2949
2950
2951
2952
2953
2954
2955
2956
2957
2958
2959
2960
2961
2962
2963
2964
2965
2966
2967
2968
2969
2970
2971
2972
2973
2974
2975
2976
2977
2978
2979
2980
2981
2982
2983
2984
2985
2986
2987
2988
2989
2990
2991
2992
2993
2994
2995
2996
2997
2998
2999
3000
3001
3002
3003
3004
3005
3006
3007
3008
3009
3010
3011
3012
3013
3014
3015
3016
3017
3018
3019
3020
3021
3022
3023
3024
3025
3026
3027
3028
3029
3030
3031
3032
3033
3034
3035
3036
3037
3038
3039
3040
3041
3042
3043
3044
3045
3046
3047
3048
3049
3050
3051
3052
3053
3054
3055
3056
3057
3058
3059
3060
3061
3062
3063
3064
3065
3066
3067
3068
3069
3070
3071
3072
3073
3074
3075
3076
3077
3078
3079
3080
3081
3082
3083
3084
3085
3086
3087
3088
3089
3090
3091
3092
3093
3094
3095
3096
3097
3098
3099
3100
3101
3102
3103
3104
3105
3106
3107
3108
3109
3110
3111
3112
3113
3114
3115
3116
3117
3118
3119
3120
3121
3122
3123
3124
3125
3126
3127
3128
3129
3130
3131
3132
3133
3134
3135
3136
3137
3138
3139
3140
3141
3142
3143
3144
3145
3146
3147
3148
3149
3150
3151
3152
3153
3154
3155
3156
3157
3158
3159
3160
3161
3162
3163
3164
3165
3166
3167
3168
3169
3170
3171
3172
3173
3174
3175
3176
3177
3178
3179
3180
3181
3182
3183
3184
3185
3186
3187
3188
3189
3190
3191
3192
3193
3194
3195
3196
3197
3198
3199
3200
3201
3202
3203
3204
3205
3206
3207
3208
3209
3210
3211
3212
3213
3214
3215
3216
3217
3218
3219
3220
3221
3222
3223
3224
3225
3226
3227
3228
3229
3230
3231
3232
3233
3234
3235
3236
3237
3238
3239
3240
3241
3242
3243
3244
3245
3246
3247
3248
3249
3250
3251
3252
3253
3254
3255
3256
3257
3258
3259
3260
3261
3262
3263
3264
3265
3266
3267
3268
3269
3270
3271
3272
3273
3274
3275
3276
3277
3278
3279
3280
3281
3282
3283
3284
3285
3286
3287
3288
3289
3290
3291
3292
3293
3294
3295
3296
3297
3298
3299
3300
3301
3302
3303
3304
3305
3306
3307
3308
3309
3310
3311
3312
3313
3314
3315
3316
3317
3318
3319
3320
3321
3322
3323
3324
3325
3326
3327
3328
3329
3330
3331
3332
3333
3334
3335
3336
3337
3338
3339
3340
3341
3342
3343
3344
3345
3346
3347
3348
3349
3350
3351
3352
3353
3354
3355
3356
3357
3358
3359
3360
3361
3362
3363
3364
3365
3366
3367
3368
3369
3370
3371
3372
3373
3374
3375
3376
3377
3378
3379
3380
3381
3382
3383
3384
3385
3386
3387
3388
3389
3390
3391
3392
3393
3394
3395
3396
3397
3398
3399
3400
3401
3402
3403
3404
3405
3406
3407
3408
3409
3410
3411
3412
3413
3414
3415
3416
3417
3418
3419
3420
3421
3422
3423
3424
3425
3426
3427
3428
3429
3430
3431
3432
3433
3434
3435
3436
3437
3438
3439
3440
3441
3442
3443
3444
3445
3446
3447
3448
3449
3450
3451
3452
3453
3454
3455
3456
3457
3458
3459
3460
3461
3462
3463
3464
3465
3466
3467
3468
3469
3470
3471
3472
3473
3474
3475
3476
3477
3478
3479
3480
3481
3482
3483
3484
3485
3486
3487
3488
3489
3490
3491
3492
3493
3494
3495
3496
3497
3498
3499
3500
3501
3502
3503
3504
3505
3506
3507
3508
3509
3510
3511
3512
3513
3514
3515
3516
3517
3518
3519
3520
3521
3522
3523
3524
3525
3526
3527
3528
3529
3530
3531
3532
3533
3534
3535
3536
3537
3538
3539
3540
3541
3542
3543
3544
3545
3546
3547
3548
3549
3550
3551
3552
3553
3554
3555
3556
3557
3558
3559
3560
3561
3562
3563
3564
3565
3566
3567
3568
3569
3570
3571
3572
3573
3574
3575
3576
3577
3578
3579
3580
3581
3582
3583
3584
3585
3586
3587
3588
3589
3590
3591
3592
3593
3594
3595
3596
3597
3598
3599
3600
3601
3602
3603
3604
3605
3606
3607
3608
3609
3610
3611
3612
3613
3614
3615
3616
3617
3618
3619
3620
3621
3622
3623
3624
3625
3626
3627
3628
3629
3630
3631
3632
3633
3634
3635
3636
3637
3638
3639
3640
3641
3642
3643
3644
3645
3646
3647
3648
3649
3650
3651
3652
3653
3654
3655
3656
3657
3658
3659
3660
3661
3662
3663
3664
3665
3666
3667
3668
3669
3670
3671
3672
3673
3674
3675
3676
3677
3678
3679
3680
3681
3682
3683
3684
3685
3686
3687
3688
3689
3690
3691
3692
3693
3694
3695
3696
3697
3698
3699
3700
3701
3702
3703
3704
3705
3706
3707
3708
3709
3710
3711
3712
3713
3714
3715
3716
3717
3718
3719
3720
3721
3722
3723
3724
3725
3726
3727
3728
3729
3730
3731
3732
3733
3734
3735
3736
3737
3738
3739
3740
3741
3742
3743
3744
3745
3746
3747
3748
3749
3750
3751
3752
3753
3754
3755
3756
3757
3758
3759
3760
3761
3762
3763
3764
3765
3766
3767
3768
3769
3770
3771
3772
3773
3774
3775
3776
3777
3778
3779
3780
3781
3782
3783
3784
3785
3786
3787
3788
3789
3790
3791
3792
3793
3794
3795
3796
3797
3798
3799
3800
3801
3802
3803
3804
3805
3806
3807
3808
3809
3810
3811
3812
3813
3814
3815
3816
3817
3818
3819
3820
3821
3822
3823
3824
3825
3826
3827
3828
3829
3830
3831
3832
3833
38

SLAB C2				
LOAD	Deflection		Elongation	
	Reading	Actual	Reading	Actual
0	0	.0000"	.43	.000000"
140	$\frac{1}{4}$.0039"	.48	.000017"
300	$\frac{1}{2}$.0078"	.55	.000041"
425	$\frac{5}{8}$.0097"	.60	.000058"
520	$\frac{7}{8}$.0136"	.65	.000075"
640	1	.0156"	.72	.000099"
750	$1\frac{1}{4}$.0195"	.77	.000116"
850	$1\frac{3}{4}$.0273"	.83	.000136"
940	2	.0312"	.87	.000150"
1000	$2\frac{1}{2}$.0391"	.89	.000156"
1060	$2\frac{1}{2}$.0391"	1.00	.000194"
1125	3	.0469"	1.13	.000238"
1190	$3\frac{1}{2}$.0547"	1.32	.000309"
1230	$3\frac{1}{2}$.0547"	1.50	.000364"
1290	$3\frac{3}{4}$.0586"	1.58	.000391"
1350	4	.0625"	1.67	.000422"
1360	$4\frac{3}{4}$.0742"	2.04	.000547"
1400	$4\frac{3}{4}$.0742"	2.07	.000558"
1430	5	.0781"	2.13	.000578"
1475	5	.0781"	2.17	.000592"
1500	5	.0781"	2.18	.000595"
1525	$5\frac{3}{4}$.0898"	-	-
1575	$6\frac{1}{4}$.0977"	-	-

Load recorded in lbs. per sq. ft.

Deflection reading measured in 64ths. of an inch.

TABLE I

CEMENT TEST.

7 DAYS				28 DAYS			
Compression Lbs. per sq. in.		Tension Lbs. per sq. in.		Compression Lbs. per sq. in.		Tension Lbs. per sq. in.	
Neat	1:3	Neat	1:3	Neat	1:3	Neat	1:3
6620	375	668	121	6985	430	985	157
4225	460	691	106	7830	600	968	140
6900	300	589	128	11500	455	800	143
8260	250	662	95	11960	665	750	156
6490	435	534	180	10670	470	932	148
6520	450	538	125	11560	450	875	161
8270	325	629	130	12880		940	159
6335	450	633	117	10950		826	154

TABLE II

COMPRESSION TEST OF 6" CUBES.			
Concrete as in	Age days	Crushing Load	Strength lbs per sq. in.
Slab A	163	98150	2726
" "	163	89100	2475
" "	163	117180	3255
" B	159	127000	3527
" "	159	108200	3005
" C	156	129000	3582
" "	156	127000	3527
" "	156	115250	3200
" D	156	106000	2944
" "	156	108880	3023
	AVERAGE		3126.

TABLE III

STEEL TEST			
<i>Test Piece</i>	<i>Yield Point Lbs. per sq. in.</i>	<i>Tensile Strength Lbs. per sq. in.</i>	<i>Ductility</i>
1	52200	63230	22 %
2	50200	64540	23 %
3	49540	64000	23 %
<i>Average</i>	50647	63923	22.67 %




AT THE
INSTITUTE OF LECTURE AND
PRACTICE

TABLE IV

SLAB DATA			
Slab	Age	Nature of Concrete	Manner of Reinforcing
A ₁	144	Medium	Long Span 4" C. to C.
A ₂	147	"	"
B ₁	150	Wet	Short Span 4" C. to C.
B ₂	152	"	"
C ₁	163	Very Wet	Both Spans 4 C. to C.
C ₂	168	" "	"
D ₁	170	" "	Both Spans 8" C. to C.
D ₂	172	" "	"


AT THE
INSTITUTE OF TECHNOLOGY
CAMBRIDGE

Plate I

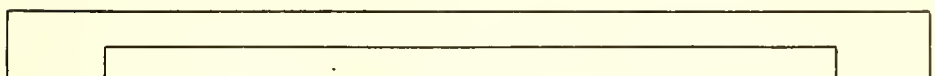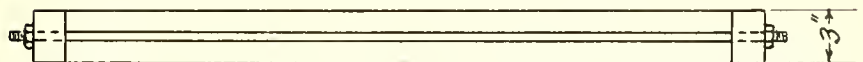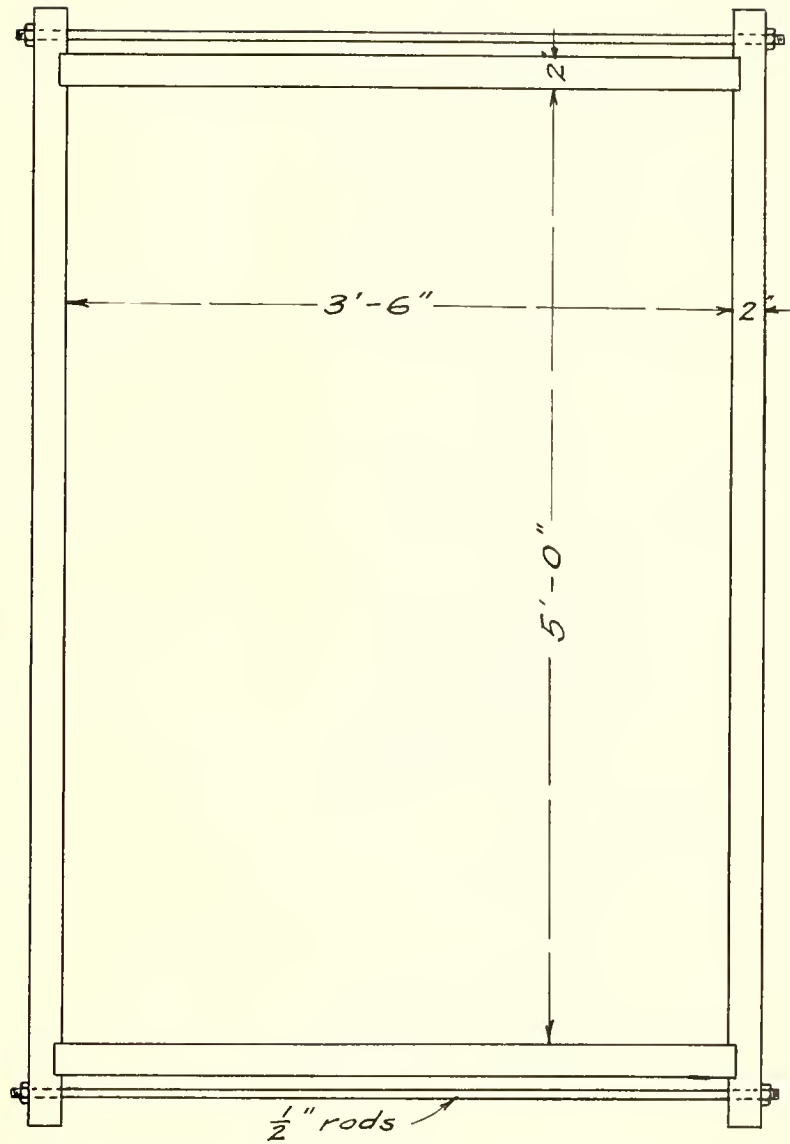



Cross Tie

Calibration Curve
of
Extensometer

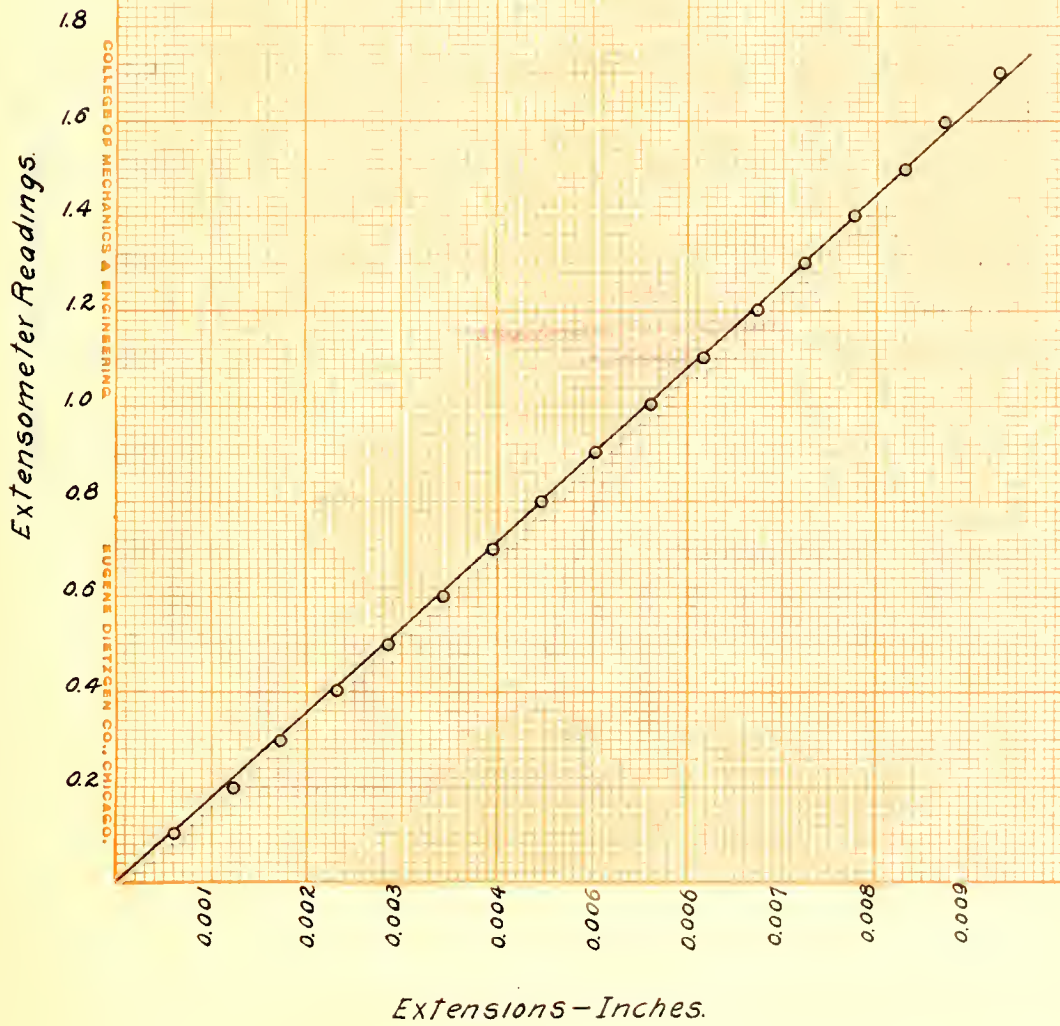


Calibration Curve
of
Extensometer

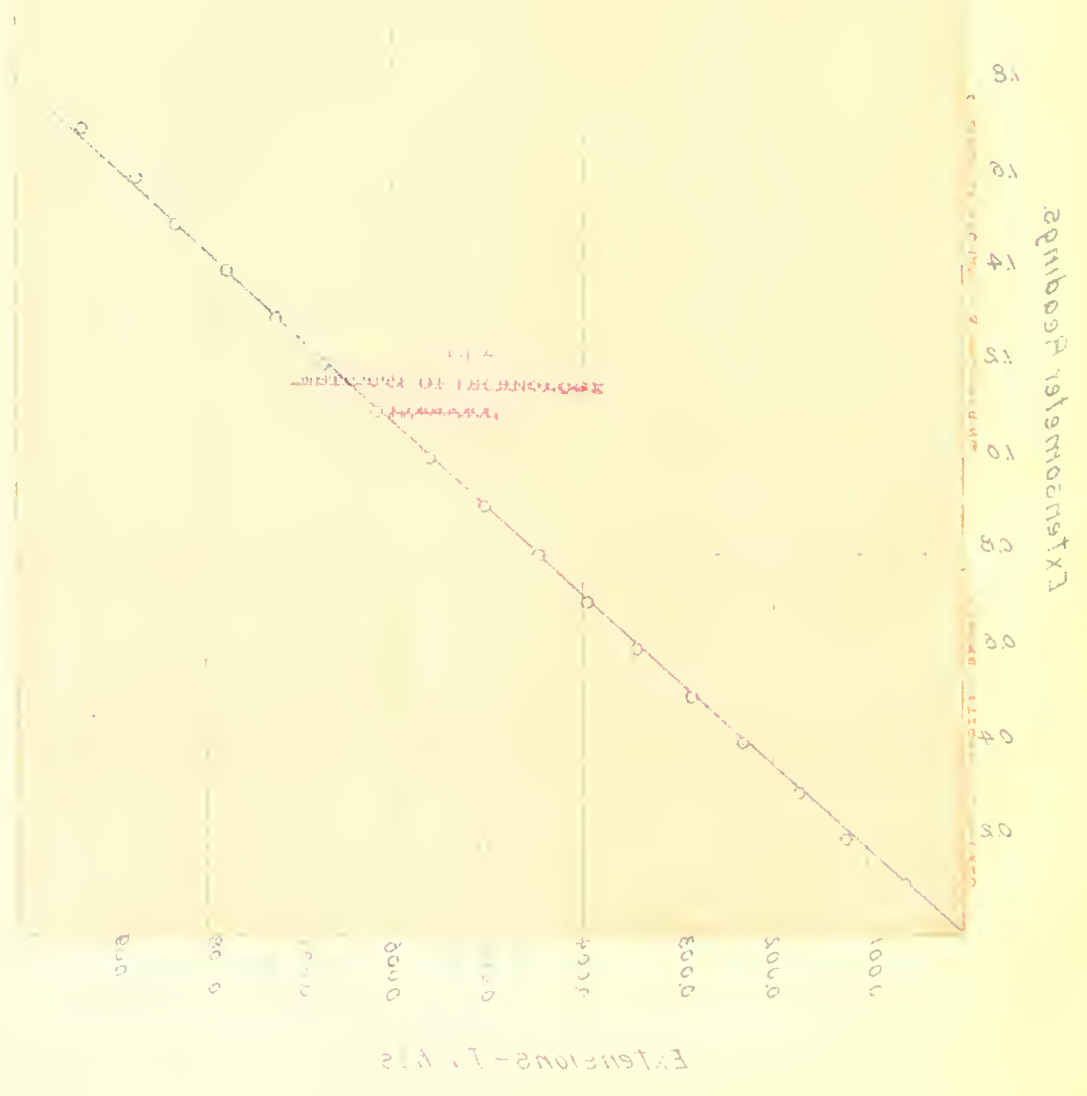

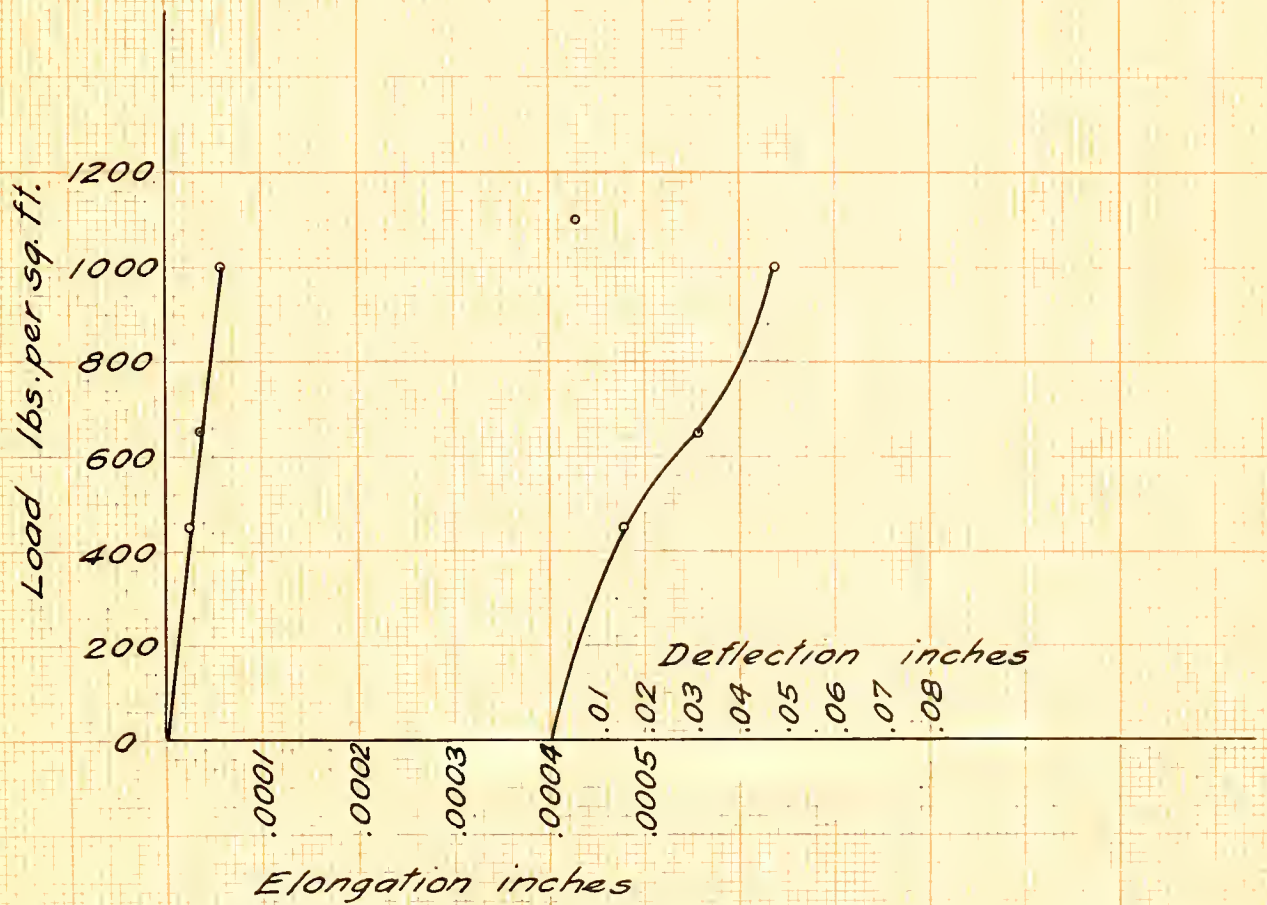


SLAB A1

ASSOCIATES OF TECHNOLOGISTS
AMSTERDAM

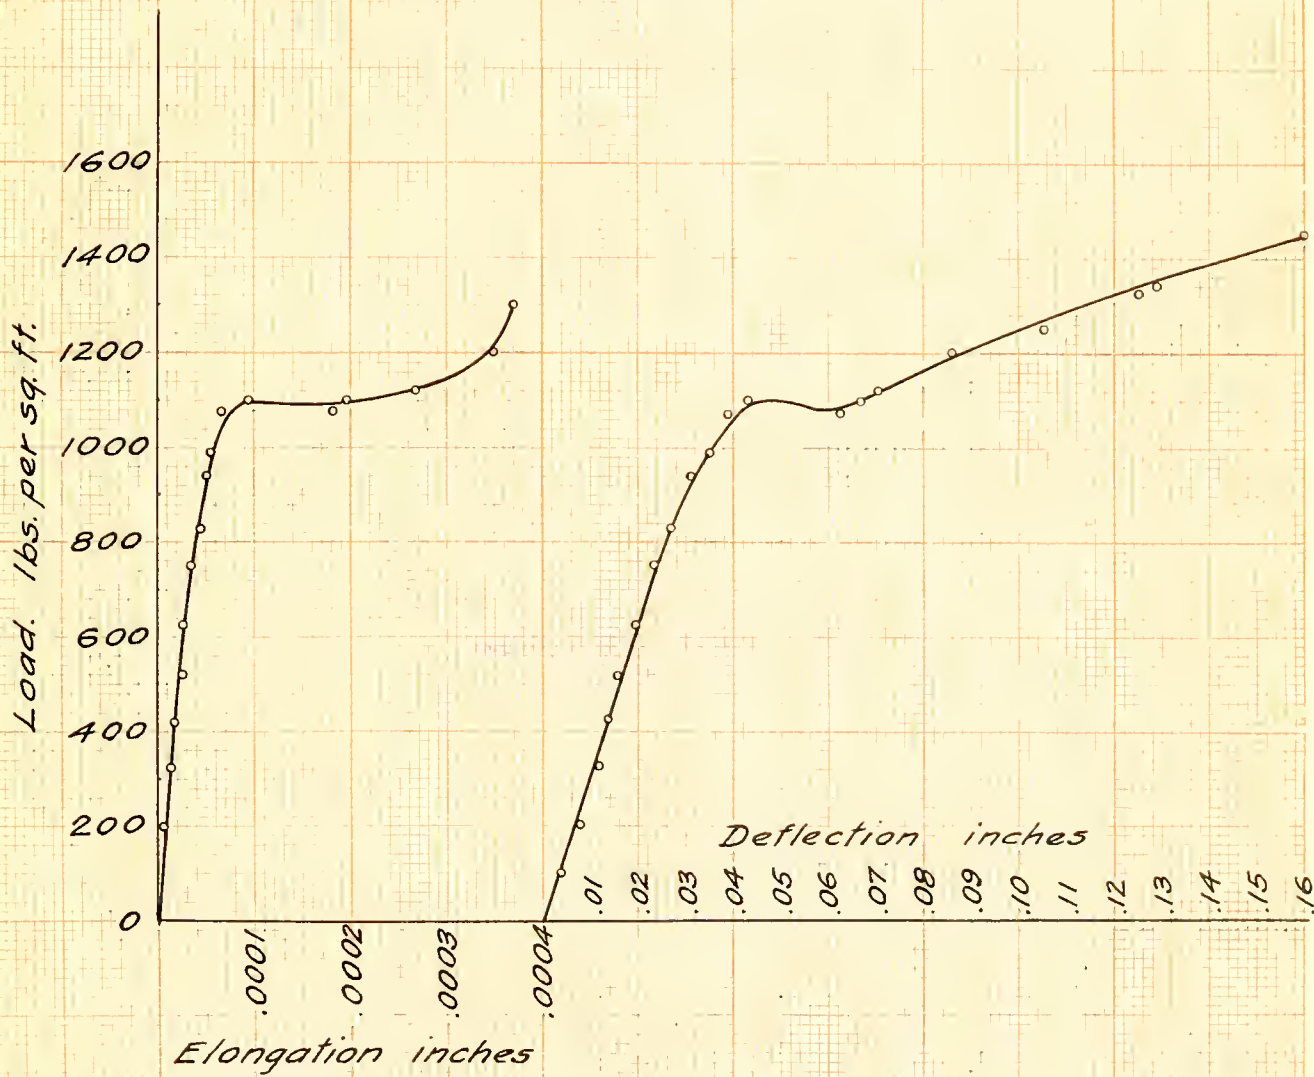


SLAB B1

THE
INSTITUTE OF TECHNOLOGY
AT
MILWAUKEE

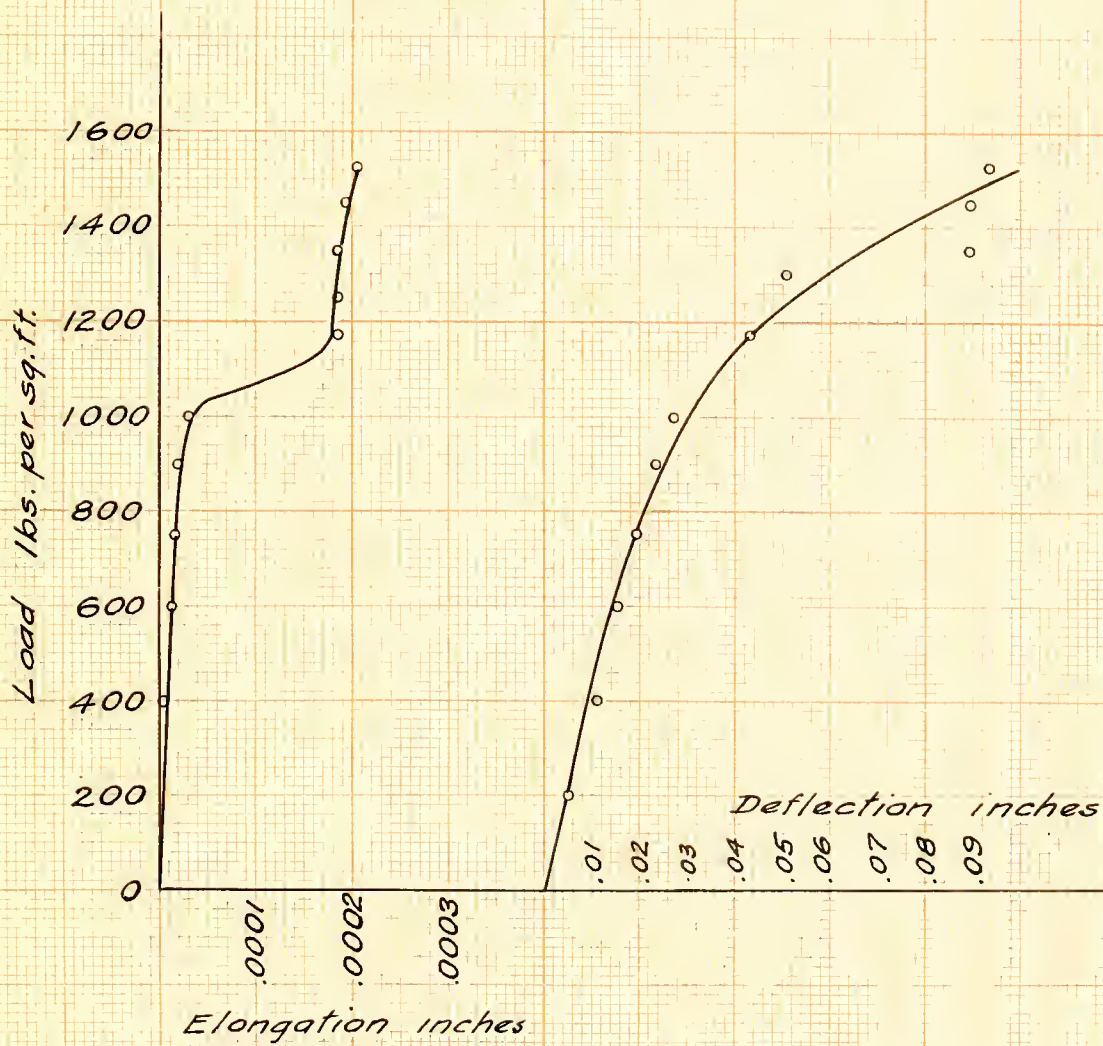


SLAB B2.

上列の通りである。

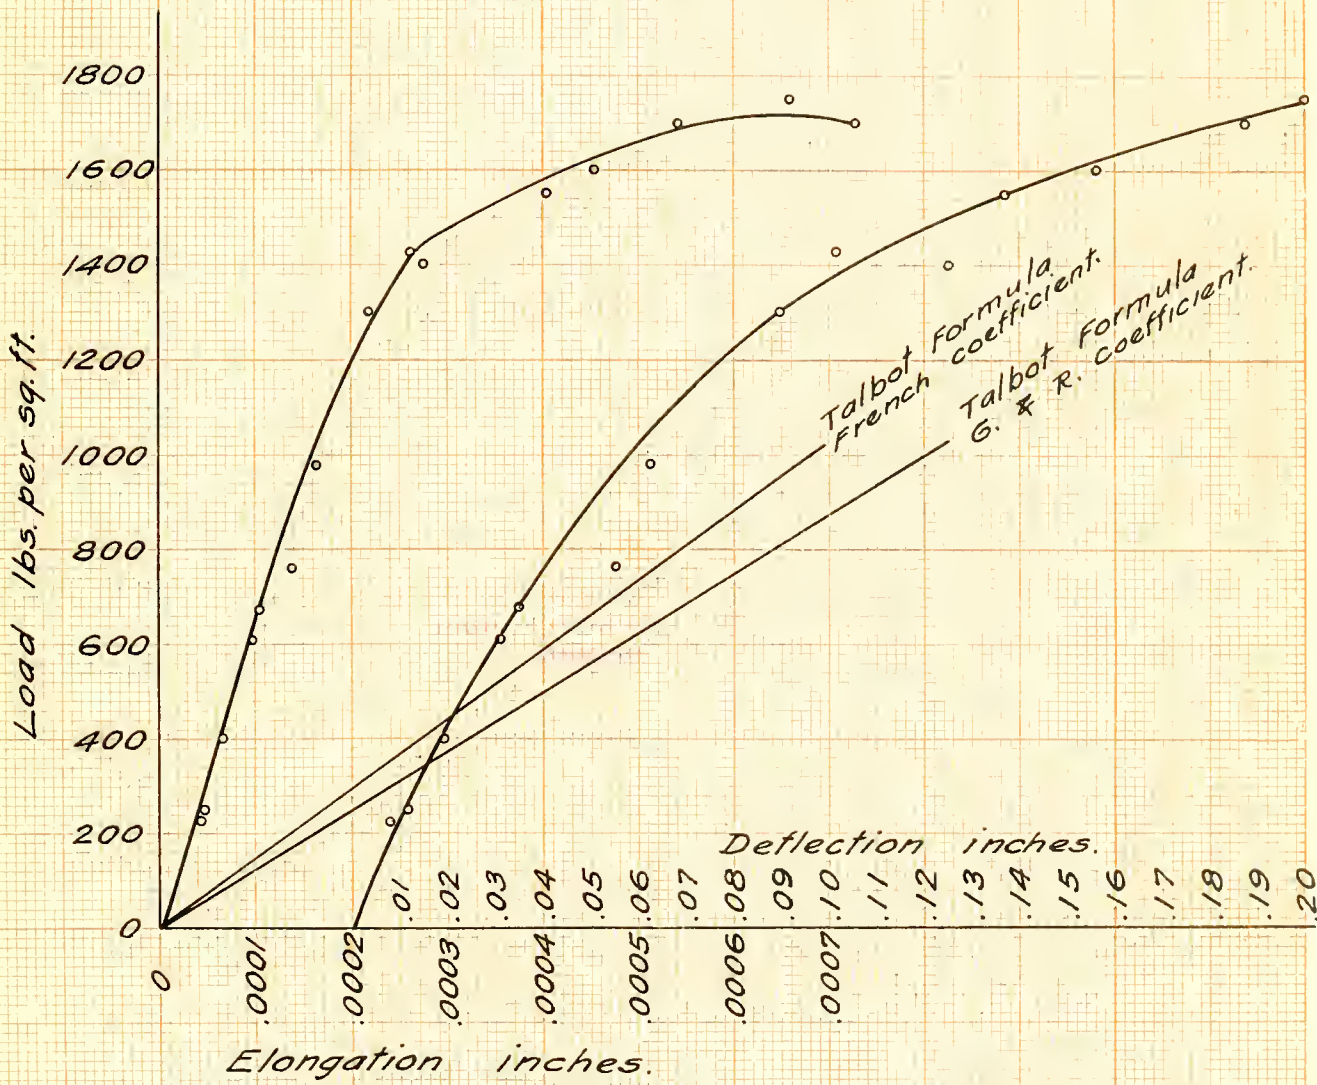

SLAB C1

INSTITUTE OF TECHNOLOGY
AMSTERS.

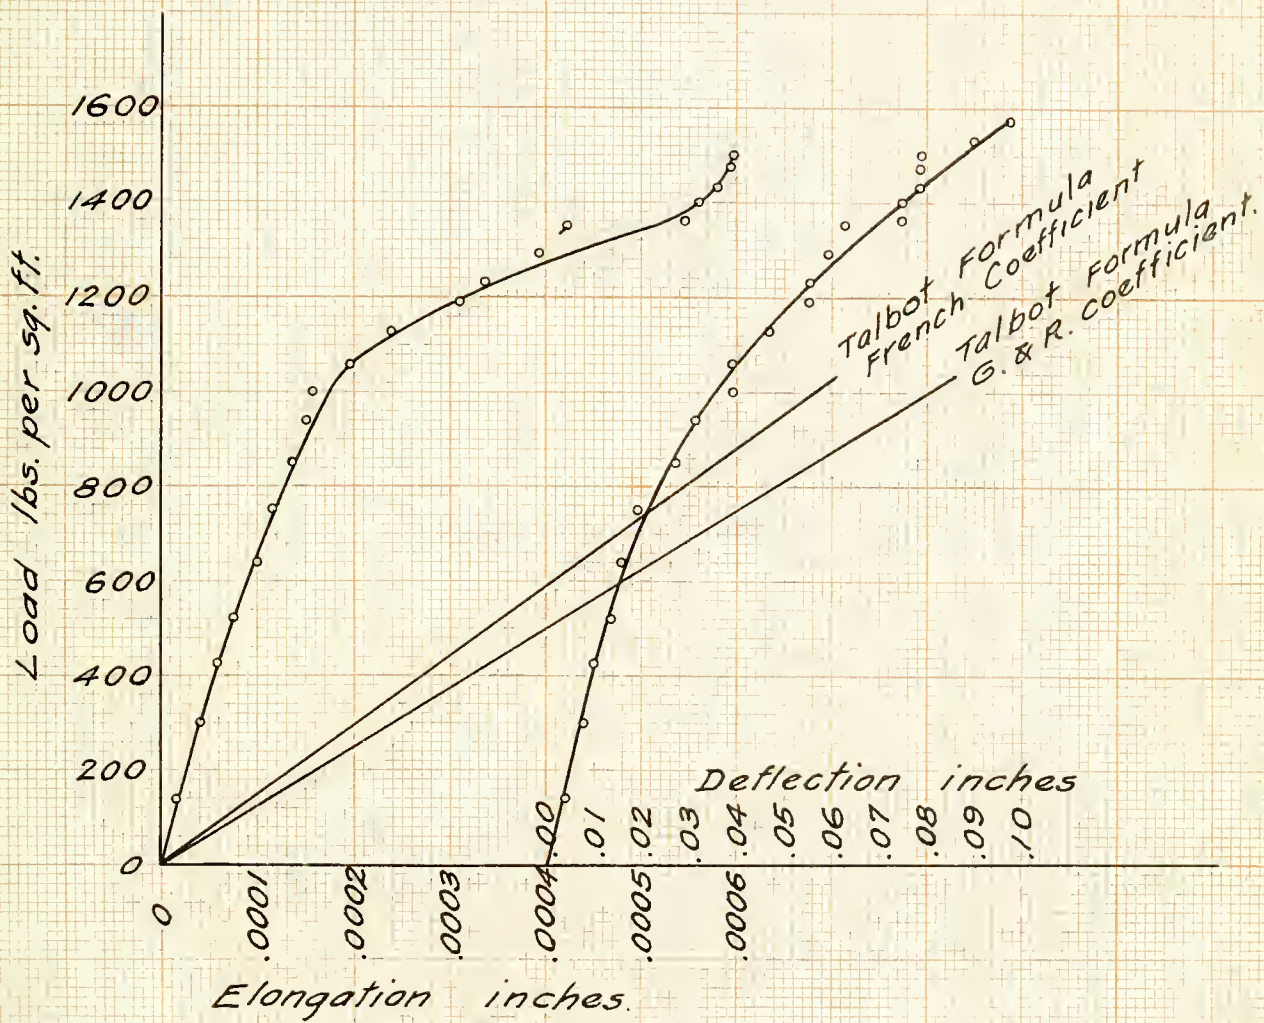

SLAB C2

MASSACHUSETTS
INSTITUTE OF TECHNOLOGY
CAMBRIDGE, MASS.

RECEIVED
JAN 10 1964
LIBRARY
OF THE
MASSACHUSETTS
INSTITUTE OF TECHNOLOGY
CAMBRIDGE, MASS.

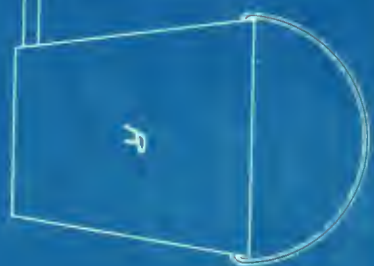


PLATE 2
ARRANGEMENT




INSTITUTE OF TECHNOLOGY
CAMBRIDGE


PLATE 2 ARRANGEMENT OF

TEST APPARATUS.

SCALE 1/2 INCH = 1 FOOT MAY 1909.


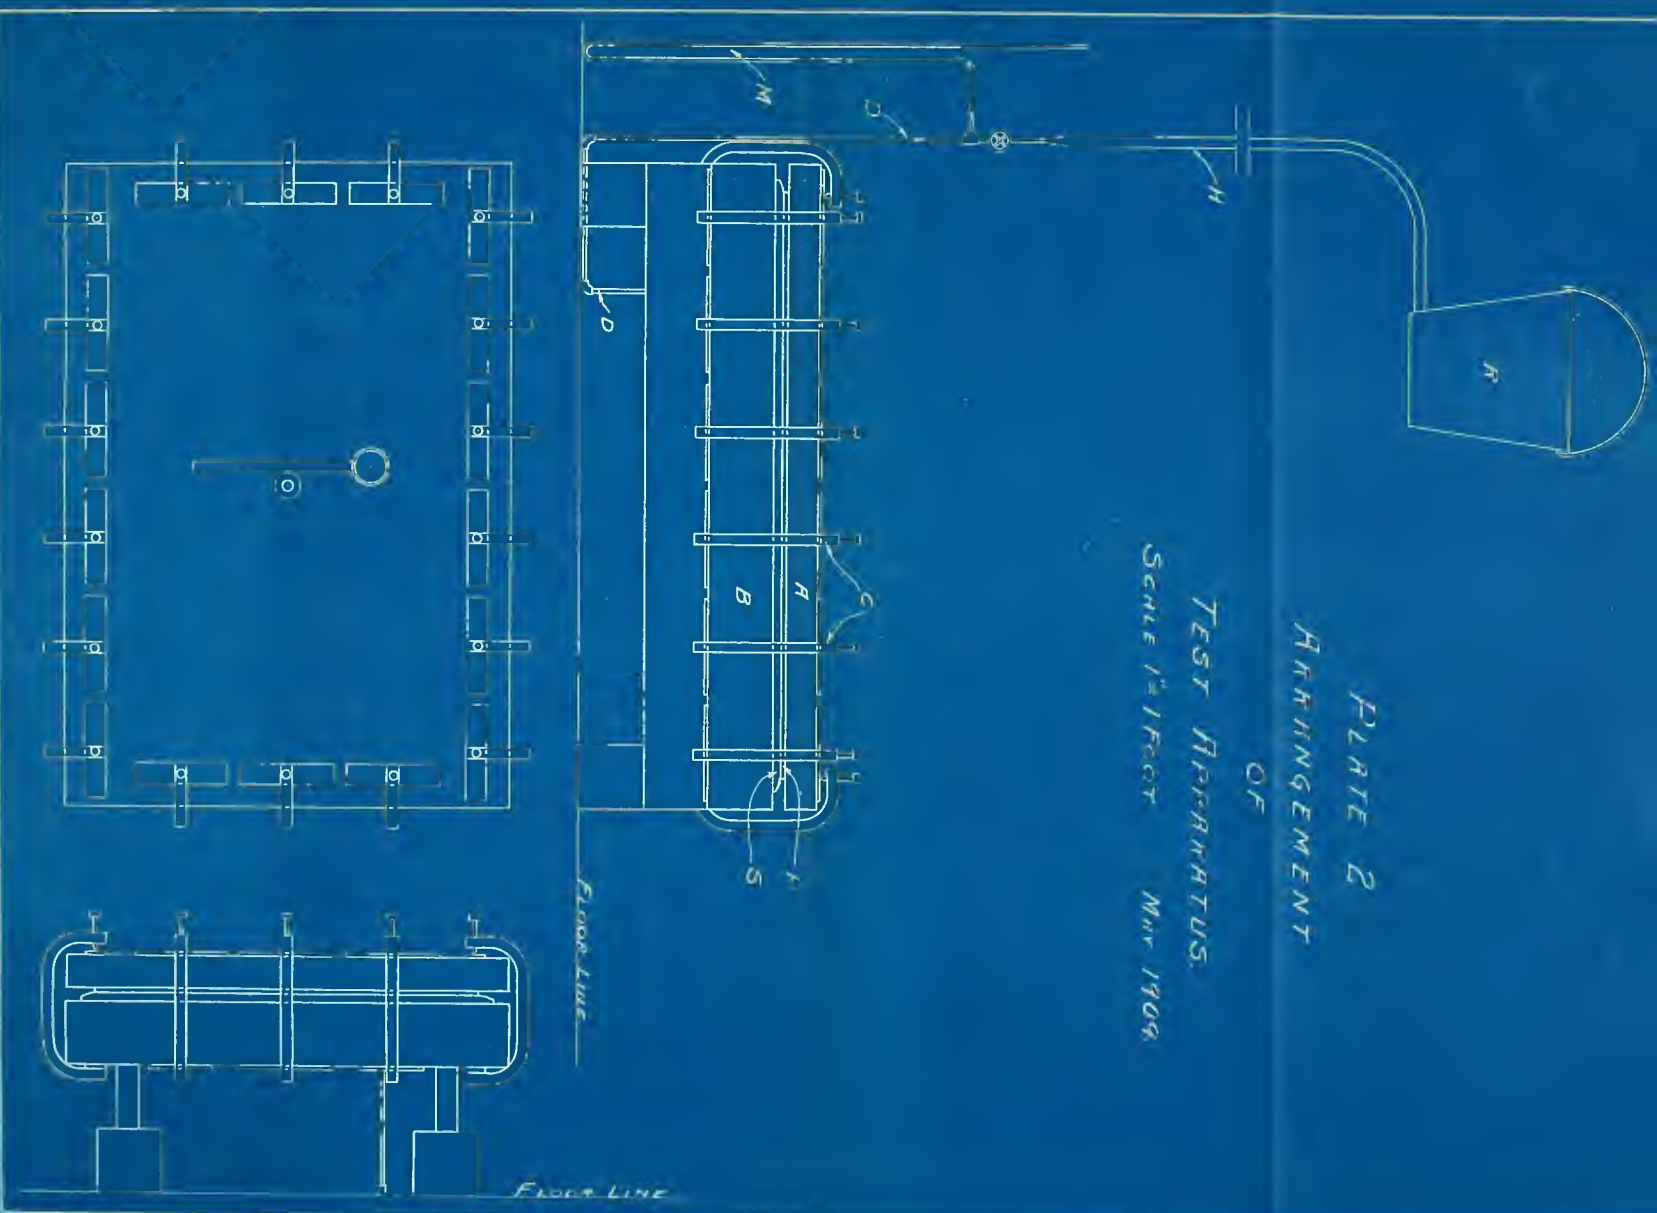


ARMOUR
INSTITUTE OF TECHNOLOGY
MILWAUKEE.

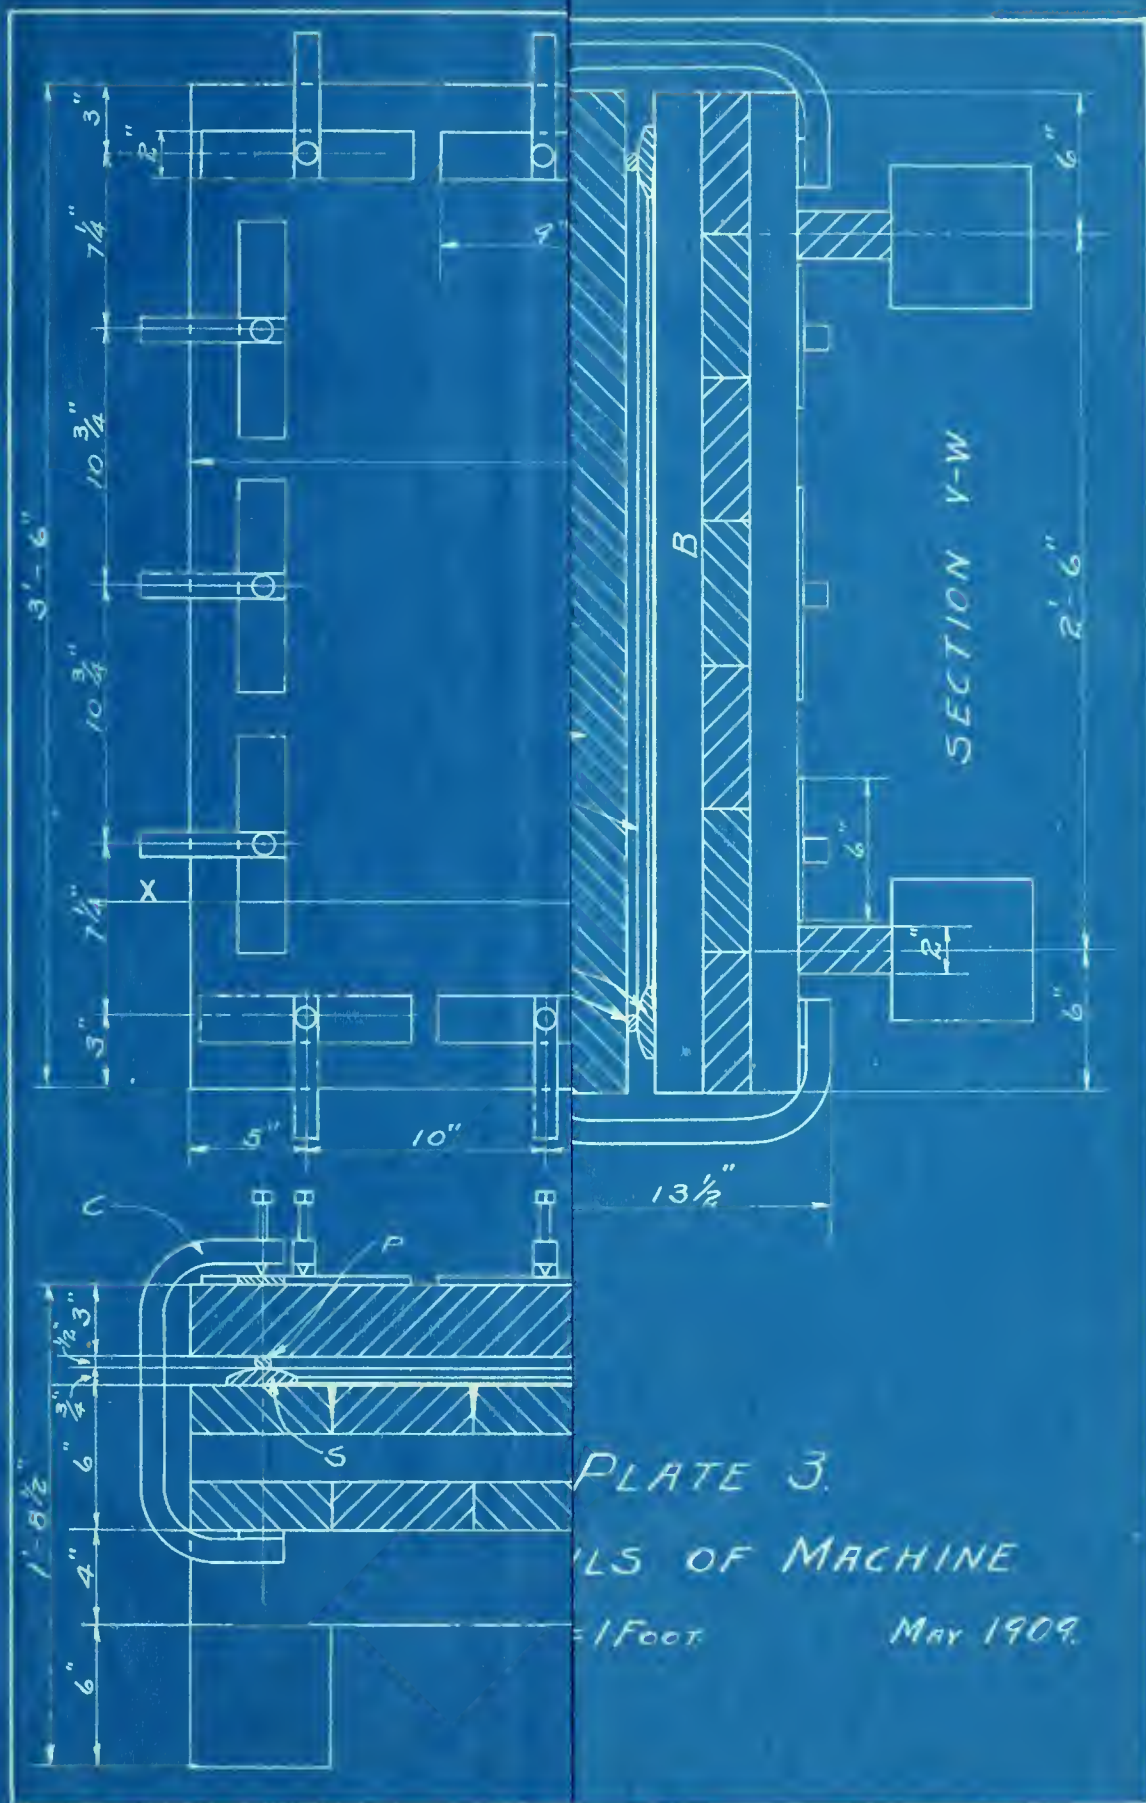

ARMOUR
INSTITUTE OF TECHNOLOGY
MILWAUKEE.

ARMY
INSTITUTE OF TECHNOLOGY
BOMBAY.

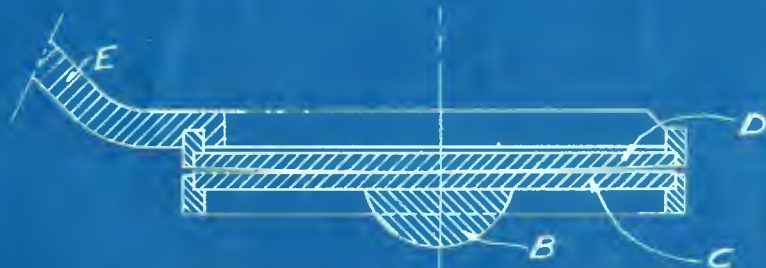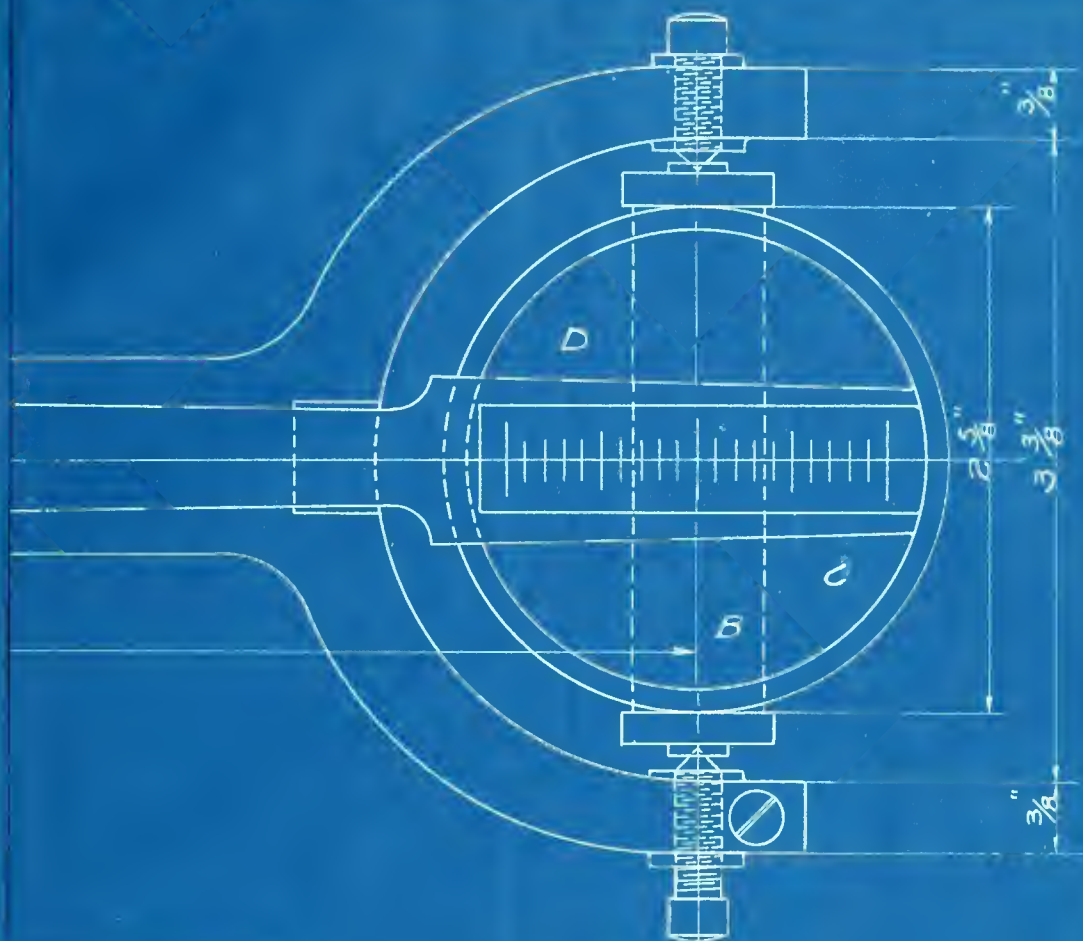


ARMSTRONG
INSTITUTE OF TECHNOLOGY
BOSTON.

PLATE 4
EXTENSOMETER

SCALE FULL SIZE

MAY 1909

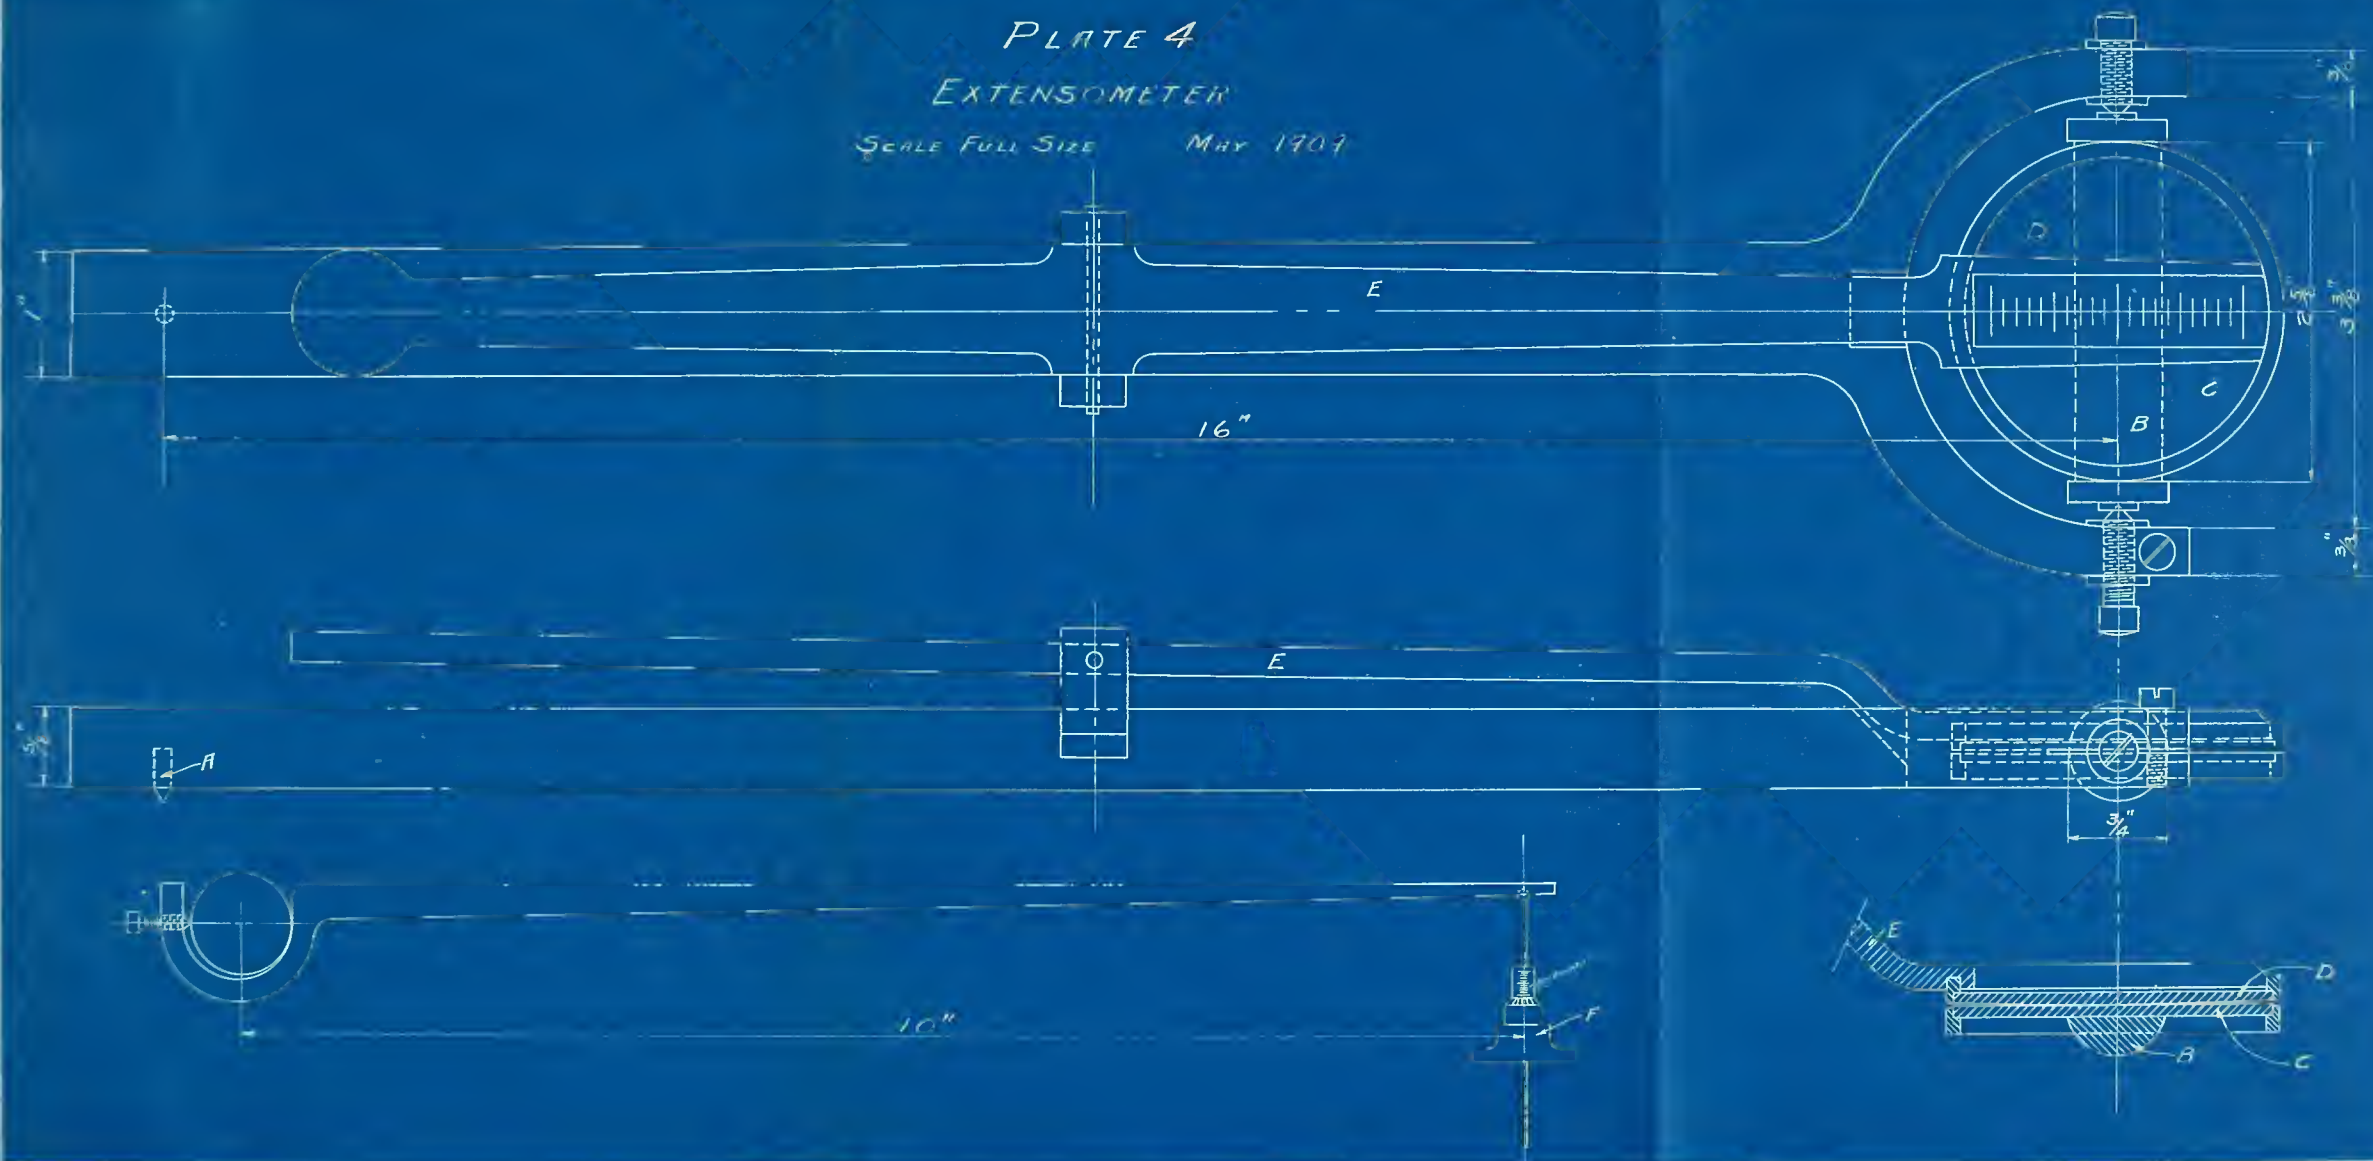

AL
INSTITUTE OF SCIENCE
BOSTON, MASS.



